

# INSTRUCTION MANUAL

## BS-7DS

Swivel Head Metal Cutting Band Saw (240V)  
215 x 178mm (W x H) Rectangle



B008A



# WARNING !

Some dust created by power sanding, sawing, grinding, drilling, and other construction activities contains chemicals known to the State of California to cause cancer, birth defects or other reproductive harm. Some examples of these chemical are:

- Lead from lead-based paints.
- Crystalline silica from bricks, cement and other masonry products.
- Arsenic and chromium from chemically-treated lumber.

Your risk from these exposures varies, depending on how often you do this type of work. To reduce your exposure to these chemicals: Work in a well ventilated area, and work with approved safety equipment, such as those dust masks that are specially designed to filter out microscopic particles.

# PLANT SAFETY PROGRAMME

## NEW MACHINERY HAZARD IDENTIFICATION, ASSESSMENT & CONTROL

**Stock Code:** B008

**Description:** Metal Cutting Bandsaw

**Model:** BS-7S

**Brand:**

HAFCO

Developed in Co-operation Between A.W.I.S.A and Australia Chamber of Manufactures

This program is based upon the Australian Worksafe Standard for Plant(NOHSC:1010-1994)

| Item No.                                                                      | Hazard Identification         | Hazard Assessment | Risk Control Strategies<br>(Recommended for Purchase / Buyer / User)                                                                                                                                                                                                                                                                                                        |
|-------------------------------------------------------------------------------|-------------------------------|-------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| A                                                                             | ENTANGLEMENT                  | HIGH              | Eliminate, avoid loose clothing / Long hair etc.                                                                                                                                                                                                                                                                                                                            |
| B                                                                             | CRUSHING                      | LOW               | Secure & support Long / heavy material                                                                                                                                                                                                                                                                                                                                      |
| C                                                                             | CUTTING, STABBING, PUNCTURING | MEDIUM            | Blade guards should always be in the closed position before starting machine.<br>Blade guide system should be adjusted to suit material width.<br>Wear gloves when changing blades.<br>Isolate main power switch before changing blade, cleaning or adjusting.<br>If blade breaks do not open door until both wheels have stopped.<br>Check blade tracking before starting. |
| D                                                                             | SHEARING                      | MEDIUM            | Make sure all guards are secured shut when machine is on.<br>Isolate power to machine prior to changing belts or maintenance.                                                                                                                                                                                                                                               |
| F                                                                             | STRIKING                      | LOW               | Support long heavy jobs and stand clear of offcuts.<br>Stand clear of machine when in operation.<br>Remove all loose objects around moving parts.<br>Wear safety glasses                                                                                                                                                                                                    |
| H                                                                             | ELECTRICAL                    | MEDIUM            | All electrical enclosures should only be opened with a tool that is not to be kept with the machine.                                                                                                                                                                                                                                                                        |
| O                                                                             | OTHER HAZARDS, NOISE.         | LOW               | Wear hearing protection as required.                                                                                                                                                                                                                                                                                                                                        |
| Plant Safety Program to be read in conjunction with manufactures instructions |                               |                   |                                                                                                                                                                                                                                                                                                                                                                             |

**HARE & FORBES**  
**MACHINERYHOUSE**

ABN 96 000 286 957

"THE JUNCTION" 2 WINDSOR ROAD, NORTHMEAD NSW 2152

Phone (02) 9890 9111 Fax (02) 9890 3888

Authorised and signed by:  
Safety officer:

Manager:

Date: Mar-02

| Table Of Contents                                | Page No |
|--------------------------------------------------|---------|
| 1 Warning .....                                  | 2       |
| 2 Safety rules for all tools .....               | 2       |
| 3 Specification .....                            | 4       |
| 4 Transportation of machine .....                | 5       |
| 5 Installation .....                             | 5       |
| 6 Minimum Room Space For Machine Operation ..... | 6       |
| 7 Make proper tooth selection .....              | 6       |
| 8 BI-Metal speeds and feeds .....                | 7       |
| 9 Assembly .....                                 | 8       |
| 10 Operation .....                               | 9       |
| 11 Blade guide bearing adjustment .....          | 14      |
| 12 Blade track adjustment .....                  | 15      |
| 13 Maintenance .....                             | 16      |
| 14 Lubrication .....                             | 17      |
| 15 Trouble Shooting .....                        | 17      |
| 16 Wiring Diagram.....                           | 19      |
| 17 Circuit Diagram .....                         | 21      |
| 18 Parts Lists & Drawing .....                   | 23      |

## CAUTION

Install saw blade and blade guard before use. Set proper blade tension to prevent any danger caused by damaged saw blade or work piece.

## **1. WARNING: FAILURE TO FOLLOW THESE RULES MAY RESULT IN SERIOUS PERSONAL INJURY**

As with all machinery there are certain hazards involved with operation and use of the machine. Using the machine with respect and caution will considerably lessen the possibility of personal injury. However, if normal safety precautions are overlooked or ignored, personal injury to the operator may result.

This machine was designed for certain applications only. We strongly recommends that this machine NOT be modified and/or used for any application other than for which it was designed. If you have any questions relative to its application DO NOT use the machine until you contact with us and we have advised you.

Always install the plastic belt cover before operating the machine.

**Your machine might not come with a power socket or plug. Before using this machine, please Do ask your local dealer to install the socket or plug on the power cable end**

## **2. SAFETY RULES FOR ALL TOOLS**

### **A. USER:**

(1). **WEAR PROPER APPAREL.** No loose clothing, gloves, rings, bracelets, or other jewelry to get caught in moving parts.

Non-slip foot wear is recommended. Wear protective hair covering to contain long hair.

(2). **ALWAYS WEAR EYE PROTECTION.** Refer to ANSLZ87.1 standard for appropriate recommendations.

Also use face or dust mask if cutting operation is dusty.

(3). **DON'T OVERREACH.** Keep proper footing and balance at all times.

(4). **NEVER STAND ON TOOL.** Serious injury could occur if the tool is tipped or if the cutting tool is accidentally contacted.

(5). **NEVER LEAVE TOOL RUNNING UNATTENDED. TURN POWER OFF.**

Don't leave tool until it comes to a complete stop.

(6). **DRUGS, ALCOHOL, MEDICATION.** Do not operate tool while under the influence of drug, alcohol or any medication.

(7). **MAKE SURE TOOL IS DISCONNECTED FROM POWER**

**SUPPLY.** While motor is being mounted, connected or reconnected.

(8). **ALWAYS** keep hands and fingers away from the blade.

(9). **STOP** the machine before removing chips.

(10). **SHUT- OFF** power and clean the BAND SAW and work area before leaving the machine.

### **B. USE OF MACHINE:**

(1). **REMOVE ADJUSTING KEYS AND WRENCHES.** Form habit of checking to see that keys and adjusting wrenches are removed from tool before turning it "on".

(2). **DON'T FORCE TOOL.** It will do the job better and be safer at the rate for which it was designed.

(3). **USE RIGHT TOOL.** Don't force tool or attachment to do a job for which it was not designed.

(4). **SECURE WORK.** Use clamps or a vise to hold work when practical. It's safer than using your hand frees both hands to operate tool.

(5). **MAINTAIN TOOLS IN TOP CONDITION.** Keep tools sharp and clean

for best and safest performance. Follow instructions for lubricating and changing accessories.

**(6). USE RECOMMENDED**

**ACCESSORIES.** Consult the owner's manual for recommended accessories. The use of improper accessories may cause hazards.

**(7). AVOID ACCIDENTAL STARTING.**

Make sure switch is in "OFF" position before plugging in power cord.

**(8). DIRECTION OF FEED.** Feed work into a blade or cutter against the direction of rotation of the blade or cutter only.

**(9). ADJUST AND POSITION** the blade guide arm before starting the cut.

**(10). KEEP BLADE GUIDE ARM TIGHT,** A loose blade guide arm will affect sawing accuracy .

**(11). MAKE SURE** blade speed is set correctly for material being cut.

**(12). CHECK** for proper blade size and type.

**(13). STOP** the machine before putting material in the vise.

**(14). ALWAYS** have stock firmly clamped in vise before starting cut.

**(15). GROUND ALL TOOLS.** If tool is equipped with three-prong plug, it should be plugged into a three-hole electrical receptacle. If an adapter is used to accommodate a two-prong receptacle, the adapter lug must be attached to a known ground. Never removed the third prong.

**C. ADJUSTMENT :**

**MAKE** all adjustments with the power off. In order to obtain the machine. Precision and correct ways of adjustment while assembling, the user should read the detailed instruction in this manual.

**D. WORKING ENVIRONMENT:**

**(1). KEEP WORK AREA CLEAN.**

Cluttered areas and benches invite accidents.

**(2). DON'T USE IN DANGEROUS**

**ENVIRONMENT.** Don't use power tools in damp or wet locations, or expose them to rain. Keep work area well-lighted.

**(3). KEEP CHILDREN AND VISITORS**

**AWAY.** All children and visitors should be kept a safe distance from work area.

**(4). DON'T** install & use this machine in explosive, dangerous environment.

**E. MAINTENANCE:**

**(1). DISCONNECT** machine from power source when making repairs.

**(2). CHECK DAMAGED PARTS.** Before further use of the tool, a guard or other part that is damaged should be carefully checked to ensure that it will operate properly and perform its intended function check for alignment of moving parts, binding of moving parts, breakage of parts, mounting, and any other conditions that may affect its operation. A guard or other part that is damaged should be properly repaired or replaced.

**(3). DISCONNECT TOOLS** before servicing and when changing accessories such as blades, bits, cutters, etc.

**(4). MAKE SURE** that blade tension and blade tracking are properly adjusted.

**(5). RE-CHECK** blade tension after initial cut with a new blade.

**(6). TO PROLONG BLADE LIFE**

**ALWAYS** release blade tension at the end of each work day.

**(7). CHECK COOLANT DAILY**

Low coolant level can cause foaming and high blade temperatures. Dirty or weak coolant can clog pump, cause crooked. Cast, low cutting rate and permanent blade failure. Dirty coolant can cause the growth of

bacteria with ensuing skin irritation.

**(8). WHEN CUTTING MAGNESIUM**

**NEVER** use soluble oils or emulsions(oil-water mix) as water will greatly intensify any accidental magnesium chip fire. See your industrial coolant supplier for specific coolant recommendations when cutting magnesium.

**(9). TO PRNMT** corrosion of machined surfaces when a soluble on is used as coolant, pay particular attention to wiping dry the surfaces where fluid accumulates and does not evaporate quickly, such as between the machine bed and vise.

**F. SPECTIFIED USAGE:**

This machine is used only for general metals cutting within the range of cutting capacity.

**CAUTION :**

**READ ALL INSTRUCTION CAREFULLY BEFORE USING THIS NACHINE. SAVE THIS MANUAL.**

**G. NOISE:**

A weighted sound pressure level : 80 dB.

**H. SAFETY DEVICE:**

(1). Interlock switch on pulley cover.

As soon as the pulley cover is open, Machine will stop with the function of this switch. Do not remove this switch from machine for any reason, and check it's function frequently.

(2). Interlock switch on cutting area as soon as the cover of cutting area in open, machine will stop at once witch the function of this switch, do not remove this switch from machine for any reason, and check it's function frequently.

**3. SPECIFICATION:**

|                            |            |                                        |                       |
|----------------------------|------------|----------------------------------------|-----------------------|
| MOTOR                      |            | 0.55KW ( 3/4HP ) / 1HP                 |                       |
| Blade Size                 |            | 19.05 x 0.8 x 2362 mm ( Carbon Blade ) |                       |
| Saw Blade Speed            | 60Hz (FPM) | 90,135,195,255                         | 98,164,246,328        |
|                            | 50Hz (FPM) | 70,110,160,210                         | 81,135,203,270        |
| MODEL NO. CUTTING CAPACITY |            | 712N                                   | 712DR                 |
| 90°                        | ○(mm)      | 178(7")                                | 178(7")               |
|                            | □(mm)      | 178x305(7"x12")                        | 178x210(7"x8 1/4")    |
| 45°                        | ○(mm)      | 127(5")                                | 127(5")               |
|                            | □(mm)      | 125x120<br>(4 3/4" x 4 5/8" )          | 85x140(3 1/3"x5 1/2") |
| -45°                       | ○(mm)      |                                        | 127(5")               |
|                            | □(mm)      |                                        | 85x140(3 1/3"x5 1/2") |
| Dimension LxWxH (mm)       |            | 1235x430x955                           | 1240x620x1135         |
| N.W / G.W (kgs)            |            | 125 / 150                              | 140/165               |

|                                   |              |               |
|-----------------------------------|--------------|---------------|
| Packing Measurement<br>(mm) LxWxH | 1282x457x990 | 1320x749x1150 |
|-----------------------------------|--------------|---------------|

#### 4. TRANSPORTATION OF MACHINE:

##### Unpacking

1. Transportation to desired location before unpacking, please use lifting jack.(Fig. B)
2. Transportation after unpacking, please use heavy duty fiber belt to lift up the machine.

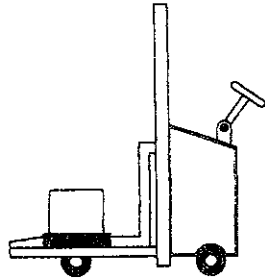


Fig. B

**ALLWAYS KEEP PROPER FOOTING & BALANCE WHILE MOVING THIS MACHINE.**

#### 5, Installation:

As this machine weights 125 kg. It is recommended that the machine shall be transported, with help of lifting jack.

##### Transportation Recommendation:

- (1). Tighten all locks before operation.
- (2). **ALWAYS** Keep proper footing & balance while moving this 125kgs machine, and only use heavy duty fiber belt to lift the machine as Fig. A
- (3). **TURN OFF** the power before wiring, & be sure machine in proper grounding, Overload & circuit breaker is recommended for safety wiring.
- (4). **CHECK** carefully if the saw blade is running in counter-clockwise direction if not , reverse the wiring per circuit diagram then repeat the running test.

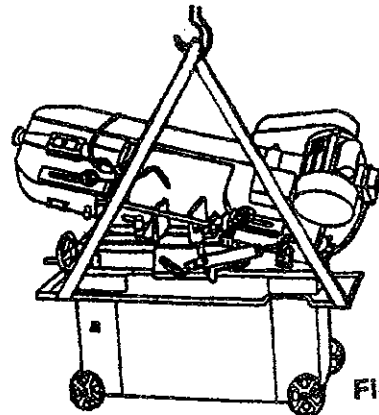


Fig. A


- (5). **KEEP** machine always out from sun, dust, wet, raining area.

##### Installation steps for plastic belt cover:


A), Open plastic moulded belt cover. Inlay the left indentation to the bottom of the pulley. If the gap is too small. Loose the fixing screws of pulley. Then, move the pulley out slightly, it will be very easy to set in.

B). Turn the belt cover with the direction of counterclockwise, which enable the indentation set into the pulley. If the gap is too small. Loose the fixing screws of pulley, and move the pulley out slightly, then, it will be easy to set in.

C). Inlay the left indentation completely to the pulley. Adjust the pulley at the same level surface, then, fix all related screws.

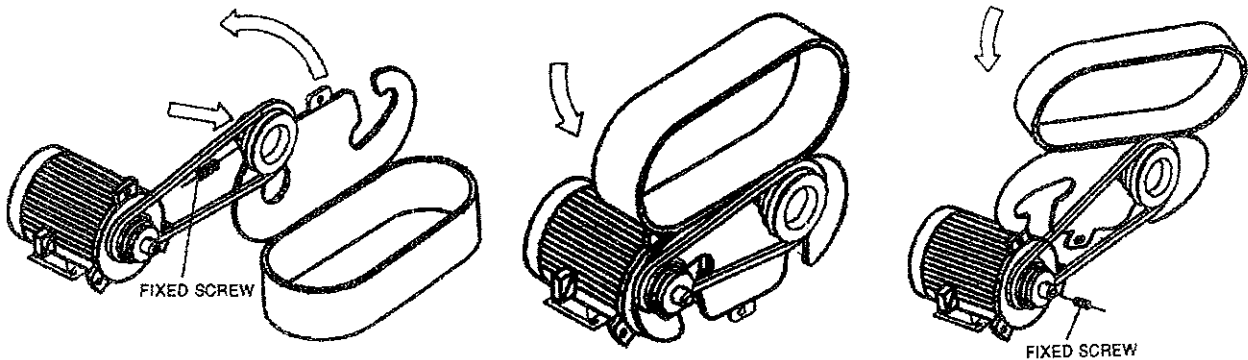

## 6. MINIMUM ROOM SPACE FOR MACHINE OPERATION

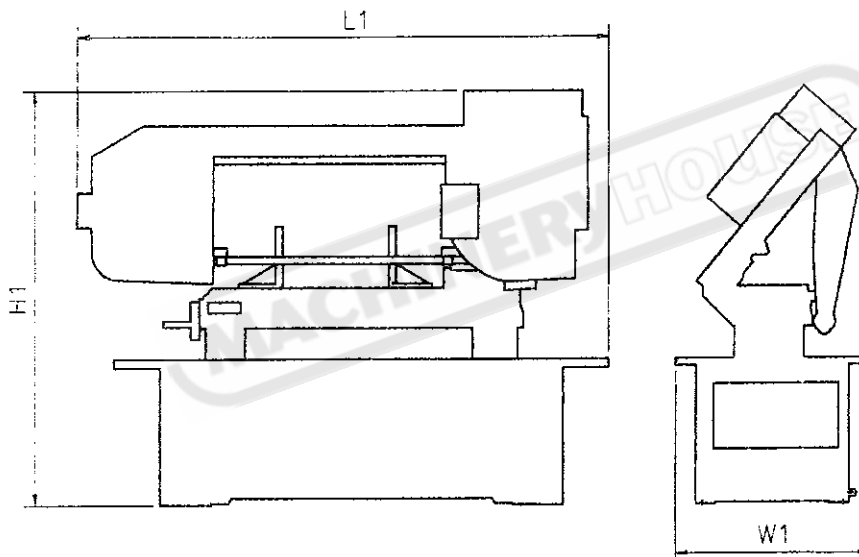

| Model No.                 | 712N           | 712DR          |
|---------------------------|----------------|----------------|
| Dimension<br>L1xW1xH1(mm) | 2240x1500x2120 | 2240x1650x2150 |

## 7. MAKE PROPER TOOTH SELECTION

For maximum cutting efficiency and lowest cost per cut, it is important to select the blade with the right number of teeth per inch (TPI) for the material being cut. The material size and shape dictate tooth selection.

### You need to consider:

- 1.The width of the cut. That is, the distance in the cut that each tooth must travel from the point it enters the workpiece until it leaves the workpiece, and
- 2.The shape of the workpiece.


● **Squares, Rectangles, Flats**  
(Symbol : ■)

Locate the width of cut on the chart.

(Inches on the outer circle and millimeters on the inner circle.) Select the tooth pitch

$$\begin{aligned} 4''(100\text{mm}) \text{ OD} &= 12.5 \text{ sq.in. (79cm}^2\text{)} \\ -3''(75 \text{ mm}) \text{ ID} &= 7.0 \text{ sq.in. (44cm}^2\text{)} \\ \hline \text{Area} &= 5.5 \text{ sq.in. (35cm}^2\text{)} \end{aligned}$$

## TOOTH SELECTION

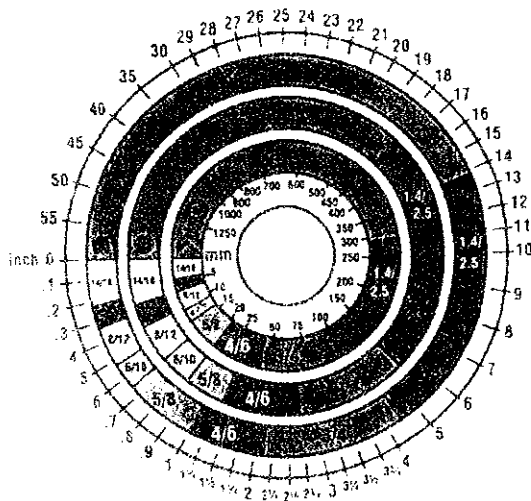

on the ring marked with the square shape which aligns with the width of cut.

EXAMPLE: 6" (150mm) square, use a 2/3 Vari-Tooth.

### ● Round Solids (Symbol : ●)

Locate the diameter of your workpiece on the chart. Select the tooth pitch on the ring marked with the round shape which aligns with the size of stock you are cutting.

EXAMPLE: 4" (100mm) round, use a 3/4 Vari-Tooth.

### ● Tubing, Pipe, Structurals( Symbol : O H ^ )

Determine the average width of cut by dividing the area of the workpiece by the distance the saw blade must travel to finish the cut. Locate the average width of cut on the chart. Select the tooth Ditch on the ring marked with the tubing and structural shape which aligns with the average width you are cutting.

EXAMPLE: 4"(100mm) outside diameter, 3"(75mm) inside diameter tubing.

$$\begin{aligned} 5.5 \text{ sq.in. (35cm}^2\text{)} / 4'' (100\text{mm}) \\ \text{distance} &= 1.38(35\text{mm}) \text{ average width} \end{aligned}$$

1.38" (35mm), use a 4/6 Vari-Tooth

**NOTE:** The band speed and cutting rate recommendations presented on this chart are approximations and are to be used as a starting point for most applications. For exact sawing parameters' consult your saw blade supplier.

## 8. BI-METAL SPEEDS AND FEEDS

These figures are a guide to cutting 4"(100mm) material (with a 314 Vari-Tooth) when using a cutting fluid.

Increase Band Speed: 15% When cutting 1/4"(6.4mm) material (10/14 Vari-Tooth)

12% When cutting 3/4"(19 mm) material (6/10 Vari-Tooth)

10% When cutting 1-1/4"(32 mm) material(5/8 Vari-Tooth)

5% When cutting 2-1/2" (64 mm) material(4/6 Vari-Tooth)

Decrease Band Speed: 12% When cutting 8"(200mm) material(2/3 Vari-Tooth)

| MATERIAL     | ALLOY<br>ASTM NO. | BAND<br>SPEED |       |
|--------------|-------------------|---------------|-------|
|              |                   | FT./MIN       | M/MIN |
| Copper Alloy | 173,932           | 314           | 96    |
|              | 330,365           | 284           | 87    |
|              | 623,624           | 264           | 81    |
|              | 230,260,272       | 244           | 74    |
|              | 280,264,632,655   | 244           | 74    |

|                      |                     |     |     |
|----------------------|---------------------|-----|-----|
|                      | 101,102,110,122,172 | 234 | 71  |
|                      | 1751,182,220,510    | 234 | 71  |
|                      | 625,706,715,934     | 234 | 71  |
|                      | 630                 | 229 | 70  |
|                      | 811                 | 214 | 65  |
| Carbon Steel         | 1117                | 339 | 103 |
|                      | 1137                | 289 | 88  |
|                      | 1141,1144           | 279 | 85  |
|                      | 1141 HI STRESS      | 279 | 85  |
|                      | 1030                | 329 | 100 |
|                      | 1008,1015,1020,1025 | 319 | 97  |
|                      | 1035                | 309 | 94  |
|                      | 1018,1021,1022      | 299 | 91  |
|                      | 1026,1513           | 299 | 91  |
|                      | A36(SHAPE S),1040   | 269 | 82  |
|                      | 1042,1541           | 249 | 76  |
|                      | 1044,1045           | 219 | 67  |
|                      | 1060                | 199 | 61  |
|                      | 1095                | 184 | 56  |
| Ni-Cr-Mo Alloy Steel | 8615,8620,8622      | 239 | 73  |
|                      | 8640,               | 199 | 61  |
|                      | E9310               | 174 | 53  |
| Tool Steel           | A-6                 | 199 | 61  |
|                      | A-2                 | 179 | 55  |
|                      | A-10                | 159 | 49  |
|                      | D-2                 | 90  | 27  |

|                 |                |     |    |
|-----------------|----------------|-----|----|
|                 | H-11,H-12,H-13 | 189 | 58 |
| Stainless Steel | 420            | 189 | 58 |
|                 | 430            | 149 | 46 |
|                 | 410,502        | 140 | 43 |
|                 | 414            | 115 | 35 |
|                 | 431            | 95  | 29 |
|                 | 440C           | 80  | 24 |
|                 | 304,324        | 120 | 36 |
|                 | 304L           | 115 | 35 |
|                 | 347            | 110 | 33 |
|                 | 316,316L       | 100 | 30 |
|                 | 416            | 189 | 58 |

### TELLTALE CHIPS

 
Chips are the best indicator of correct feed force. Monitor chip information and adjust feed accordingly.

Thin or powdered chips – increase feed rate or reduce band speed.

Burned heavy

chips – reduce feed rate and/or band speed.

Curly silvery and warm chips – optimum feed rate and band speed.



### 9. ASSEMBLY

A 3/4 HP, motor, split phase or capacitor-start is recommended for best economical performance.

Counterclockwise rotation is required. Note that rotation can be reversed by following directions

given on terminal or nameplate.

- (1). Assemble the motor Mounting plate to the head using the long bolt Note that the flat side of the plate faces up.
- (2). Assemble the guard plate to the head using the screw and Lock Washer and the Carriage Bolt Washer and Wing Nut are used to secure the motor mounting plate to the Guard plate through the slotted hole in the Guard plate. These components also serve to position and lock the motor in place for proper speed/ belt adjustment.
- (3). Place the spacer over the long Bolt and secure it with the nut .
- (4). Secure the Motor to the Motor Mounting plate with the four bolts and nuts. Note, that the motor shaft is placed through the large opening in the Guard plate and must be parallel with the drive Shaft.
- (5). Assemble the Motor Pulley, the smaller of the two provided, to the motor shaft Note, the larger diameter must be closest to the motor.  
Do not tighten the set screw.
- (6). Assemble the Driven Pulley, the larger of the two provided, to the protruding drive Shaft Note the small diameter must be closest to the bearing.  
Do not tighten the set screw.
- (7). Place the belt into one of the pulley grooves and the other end into the respective grooves of the second pulley.
- (8) Line up the belt and both pulleys such that the belt is running parallel in the pulley grooves.
- (9). Tighten the set screws of both pulleys in this position.
- (10). Place the belt into proper pulley combination for proper blade speed. See material cutting Chart .
- (11). Adjust the position of the Motor to obtain approximately 1/2" depression in the belt when applying pressure with your

thumb.

- (12). Tighten the head screw Holding the Motor Mounting plate to the Guard plate.

- (13). Connect the Electrical Harness to the motor terminal box. The motor should be protected with a time delay fuse or circuit breaker with a rated amperage slightly greater than the full load amperage of the motor.

## **10. OPERATION**

### **A. WORK SET UP:**

- (1). Raise the saw head to vertical position.
- (2). Open vise to accept the Piece to be cut by rotating the wheel at the end the base.
- (3). Place workpiece on saw bed. If the piece is long, support the end.
- (4). Clamp workpiece securely in vise.

### **B. WORK STOP ADJUSTMENT:**

- (1). Loosen the thumb screw holding the work stop casting to the shaft.
- (2). Adjust the work stop casting to the desired length position.
- (3). Rotate the work stop to as close to the bottom of the cut as possible.
- (4). Tighten thumbscrew.
- (5). DO NOT ALLOW the blade to rest on the work while the motor is shut off.

### C. BLADE SPEEDS:

When using your Band saw always change the blade speed to best suit the material being cut the material Cutting Chart gives suggested settings for several materials.

 
| Material                                                | Speed F.P.M |     |      |     | Belt Groove Used |            |
|---------------------------------------------------------|-------------|-----|------|-----|------------------|------------|
|                                                         | 60Hz        |     | 50Hz |     | Motor Pulley     | Saw Pulley |
|                                                         | A           | B   | A    | B   |                  |            |
| Tool, Stainless<br>Alloy Steels<br>Bearing Bronze       | 90          | 98  | 70   | 81  | Small            | Largest    |
| Medium to High<br>Carbon Steels<br>Hard Brass or Bronze | 135         | 164 | 110  | 135 | Medium           | Large      |
| Low to Medium<br>Carbon Steel<br>Soft Brass             | 195         | 246 | 160  | 203 | Large            | Medium     |
| Aluminum Plastic                                        | 255         | 328 | 210  | 270 | Largest          | Small      |

- ✧ A: For 712N with carbon blade
- ✧ B: For 712DR, 712N with Bi-Metal blade.

### D. BLADE DIRECTION OF TRAVEL:

Be sure the Blade is assembled to the pulleys such that the vertical edge engages the work piece first.

BLADE MOVEMENT




Blade Direction

### E. STARTING SAW:

#### E-1. Switch button function description


A ↑ Stop button

B ↑ Start button

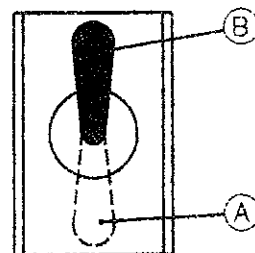

Toggle Switch


## E-2. Switch button function description (FOR CE ONLY)

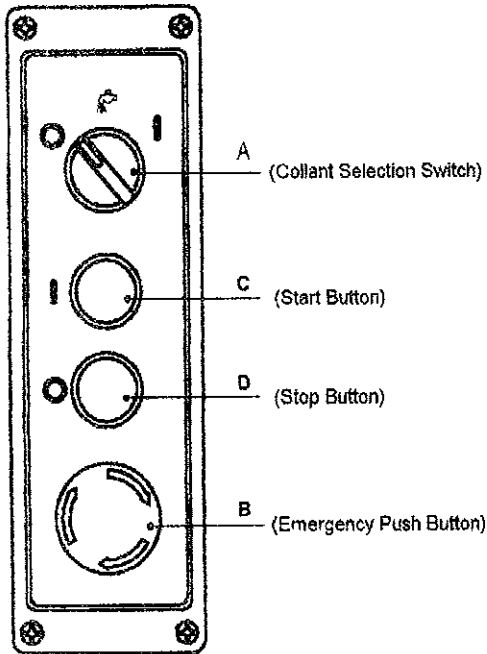


## E-3. Electromagnetic Switch

The self-latching, lockable EMERGENCY STOP button is equipped with an under voltage circuit breaker.

When the switch is in closed position, it may be secured with a padlock to prevent the machine from being turned on accidentally or by unauthorized personnel.

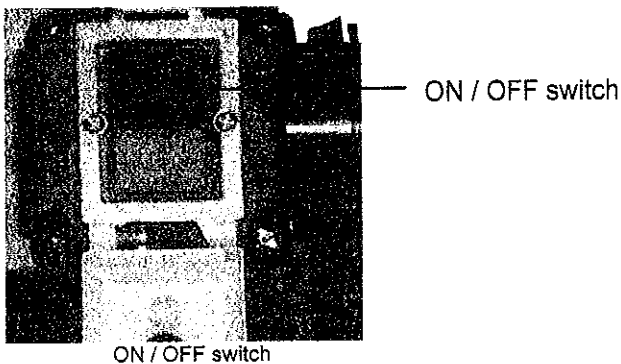

Open the cover of the switch in order to switch on the metal belt saw.  
Close the cover after switching on to guarantee correct operation of the EMERGENCY STOP function.

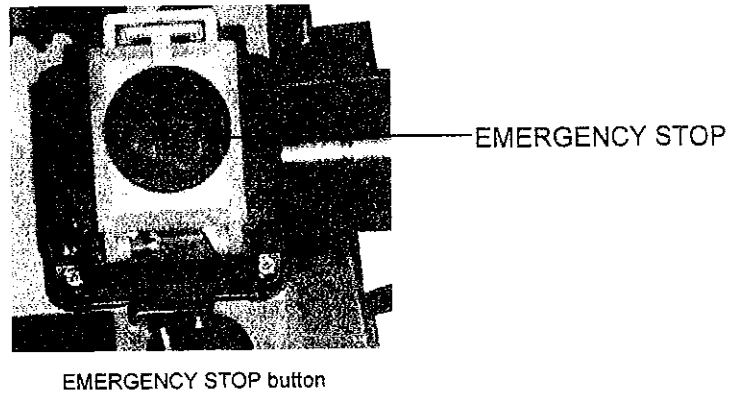

**CAUTION: NEVER OPERATE SAW WITHOUT BLADE GUARDS IN PLACE.**  
Be sure the blade is not in contact with the work when the motor is started. Start the motor, allow the saw to come to full speed, then begin the cut by letting the head down slowly onto the work. **DO NOT DROP OR FORCE.** Let the weight of the saw head provide the cutting force. The saw automatically shuts off at the end of the cut.

## F. BLADE SELECTION:

A 8-tooth per inch, general-use blade is furnished with this metal Cutting Band Saw. Additional blades in 4, 6, 8, and 10 tooth sizes are available. The choice of blade pitch is governed by the thickness of the work to be cut: the thinner the workpiece, the more teeth advised. A minimum of three (3) teeth should be against the workpiece at all times for proper cutting. If the teeth of the Blade are so far apart that they straddle the work, severe damage to the workpiece and to the Machine can result.


## G. CHANGING BLADE:

Raise saw head to vertical position and open the blade guards. Loosen tension screw knob sufficiently to allow the saw blade to slip off the wheels. Install the new blade with teeth slanting toward the motor as follows:

- (1). Place the blade in between each of the guide bearings.
- (2). Slip the blade around the motor pulley (bottom) with the left hand and hold in position.
- (3). Hold the blade taut against the motor pulley by pulling the blade upward with the right hand  
which is placed at the top of the Made.
- (4). Remove left hand from bottom pulley and place is at the top aide of the Made to continue the application on the upward pull on the blade.
- (5). Remove right hand from blade and adjust the position of the top pulley to permit left hand to slip the blade around the pulley using the thumb, index and little finger as guides.
- (6). Adjust the blade tension knob clockwise until it is just right enough so no blade slippage occurs. Do not tighten excessively.
- (7). Replace the blade guards.
- (8). Place 2-3 drops of oil on the blade.


#### H. USAGE OF THE QUICK VISE: (A)

The workpiece is placed between the vise jaws with the amount to be cut-off extending out past the blade. Your machine is equipped with a "quick action" vise jaw which allows you to instantly position the moveable vise jaw (B). Simply turn handwheel (A) counterclockwise 1/2 turn and move the vise jaw (B) to the desired position. Then tighten the vise jaw

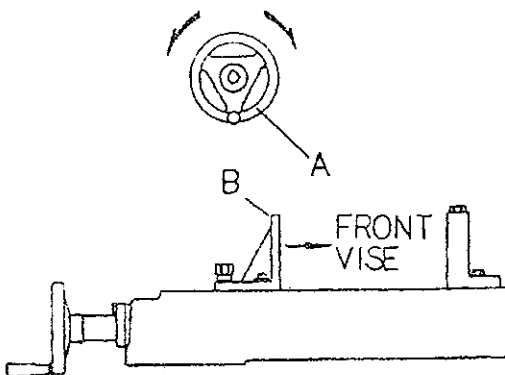


(B) against the work-piece by turning hand-wheel clockwise.


#### H. USAGE OF THE QUICK VISE: (B)

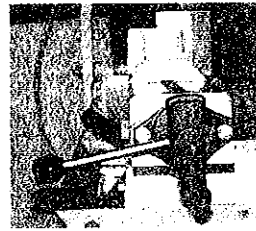

(1)

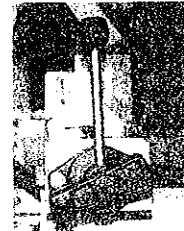

(2)

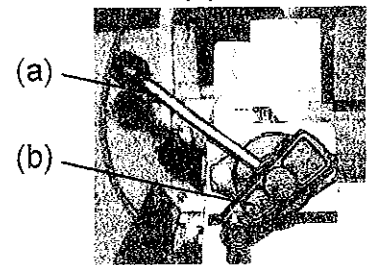

(3)

- (1) The position of the vise when tightened.
- (2) The position of the vise when loosened.  
(Completely opened).
- (3) The position of the vise when loosened.  
( Half opened).

#### TRU-LOCK VISE SYSTEM INSTRUCTIONS

To operate, proceed as follows:

- 1) Rise the arm 2" above the workpiece, close the cylinder valve to maintain the arm 2" above the workpiece.
- 2) Put your workpiece on the table.  
Move the vise handle (a) upwards to an angle of 45 degree (a-Half opened) to loosen the vise.  
Move the vise jaw bracket against the workpiece by turning the rectangular handle (b) . Push down on the vise handle (a) to lock the workpiece in position.
- 3) To loosen the workpiece from the vise, hold the workpiece and lift the vise

handle (a) to a 90 degree position (completely opened). Remove workpiece.  
**CONTINUED CUTTING**

When you need to cut a workpiece many times, just raise the vise handle (a) to loosen and adjust workpiece position. Then push down on the same handle to tighten.

You can also push the vise handle (a) down first, then tightening the vise by turning the rectangular handle (b) clockwise. After finishing the cut, you can loosen the workpiece by turning rectangular handle only.

This Tru-Lock Vise System has a 3mm tightening travel when the rectangular handle is completely opened. There is only a 1mm tightening travel necessary for normal metal materials. The operator can tighten the workpiece by pushing down the vise handle (a) with a certain amount of pressure depending on hardness of workpiece.

### I. QUICK VISE ADJUSTMENT FOR ANGLE CUT:

- (1). Loosen the A. B. C. D. Screw.
- (2). Adjust rear vise to the threaded hole position. (E)
- (3). Set the scale to the desired angle.
- (4). Adjust the front vise (F) to parallel the rear vise (E)
- (5). Tighten the A. B. C. D. Screw.

I-1 The position for 0° cutting. (The original position)(See fig1.)

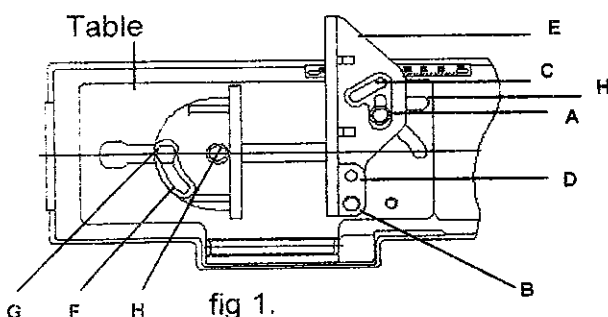


fig 1.

I-2 The position for 90° cutting. (See fig2.)

- Step: 1. Remove the screw from A to C.  
2. Remove the screw from B to D.  
3. Turn E (Rear vise) to the right.  
4. Turn F (Front vise) to the right.

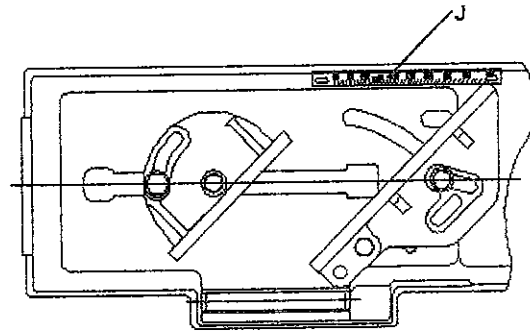


fig 2.

I-3 The position for cutting 12" workpiece. (See fig3.)

- Step: 1. Disconnect the metal belt saw from the power supply.  
2. Unscrew the bolts on the rear clamping jaw.  
3. Set the clamping jaw at a greater distance in the holes provided.  
4. Screw the clamping jaw back in.

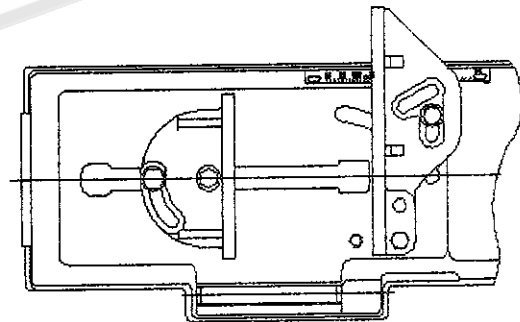


fig 3.

### J. FRONT AND REAR CUTTING OPERATION: FOR 712DR ONLY

1), For front cutting:




Push the vice base backward (far from you) to the end, fix the 3 vice base fix screws (A).

Choose the swivel arm angle you need start cutting.

2), For rear cutting:




Push the vice base backward (close to you) to the end, fix the 3 vice base fix screws (A).

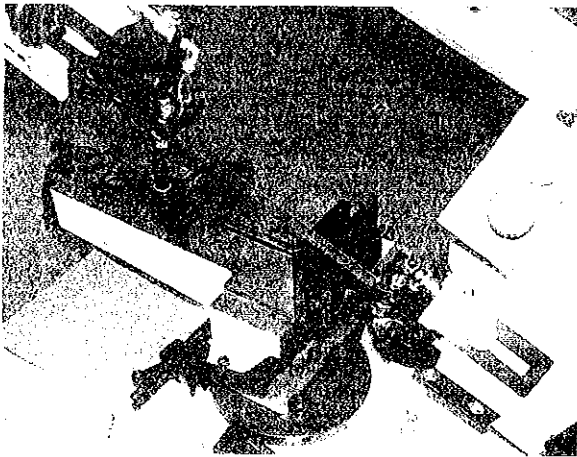

Choose the swivel arm angle you need start cutting.

#### k. HOW TO OPERATE THE SWIVEL CUTTING

- 1), Loosen the leaf screw (A)
- 2), Move the swivel bow by the hand, watch the angle scale to the desired angle.
- 3), Lock the leaf screw (A)
- 4), Adjust cylinder volume, and start cutting.

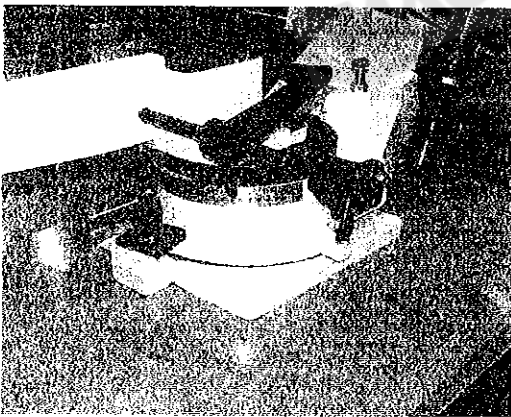

#### 11. BLADE GUIDE BEARING ADJUSTMENT

**ATTENTION:** This is the most important adjustment on your saw. It is impossible to get satisfactory work from your saw if the blade guides are not properly adjusted. The blade guide bearings on your metal Cutting Band Saw are adjusted and power

tested with several test cuts before leaving the factory to insure proper setting. The need for adjustment should rarely occur when the saw is used properly. If the guides do get out of adjustment though, it is extremely important to readjust immediately. If improper adjustment is maintained, the blade will not cut straight, and if the situation is not corrected it will cause serious blade damage. Because guide adjustment is a critical factor in the performance of your saw, it is always best to try a new blade to see if this will correct poor cutting before beginning to adjust. If a blade becomes dull on one side sooner than the other, for example, it will begin cutting crooked. A blade change will correct this problem the guide adjustment will not. If a new blade does not correct the problem, check the blade guides for proper spacing.

**NOTE:** There should be from 000 (just touching) 001 clearance between the blade and guide bearings to obtain this clearance adjust as follows:

1. The inner guide bearing is fixed and cannot be adjusted.
2. The outer guide bearing is mounted to an eccentric bushing and can be adjusted.
3. Loosen the nut while holding the bolt with an Allen wrench.
4. Position the eccentric by turning the bolt to the desired position of clearance.
5. Tighten the nut.
6. Adjust the second blade guide bearing in the same manner.

#### **REMARK:**



1. Adjust the tension of blade until the back of the blade(A) against the blade wheel (front) lightly.
2. Be sure the nut (E) is tightened.
3. Turn the eccentric shaft (B) counterclockwise, when the bearing (D)

touches the saw blade properly, tighten the nut(E).

4.To adjust, loosen set screw (F) and move the blade adjustable up or down until it lightly touches the back of the blade (A).

5. Repeat 1. 2, 3, and 4 steps to adjust the other side's blade guide bearings (G).

6. Correct the base and blade to be a vertical position with a scale. If necessary, loosen set screw (F).

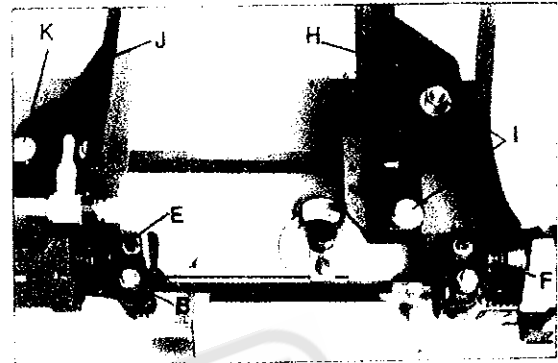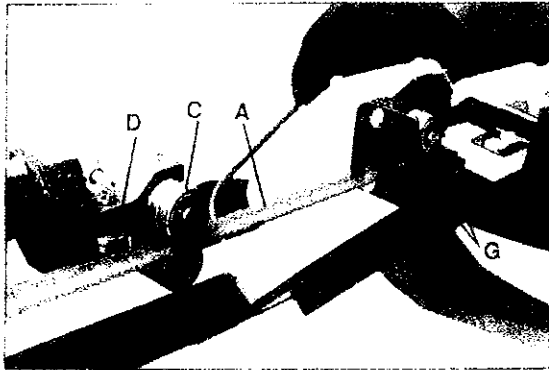

**For 712DR**, when straight cutting 12" width is required, changing Rear Vise Jaw Bracket is a MUST, by following steps.

1. Take off fix screw E, and withdraw the Rear Vise Jaw Bracket (A).

2.Link the Extension Table © to the end of the Vise Base. Fix it with Screw (D).

3.Put back the Vise Bracket (A), fix the screw (E) onto the extension table. Move backward the Front Vise Jaw Bracket.

※※ Extension table is only good for straight cutting, not for angle cutting.

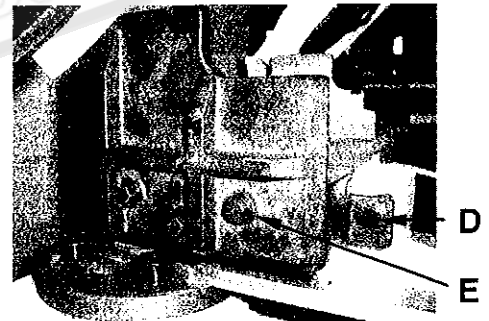


Fig. 1

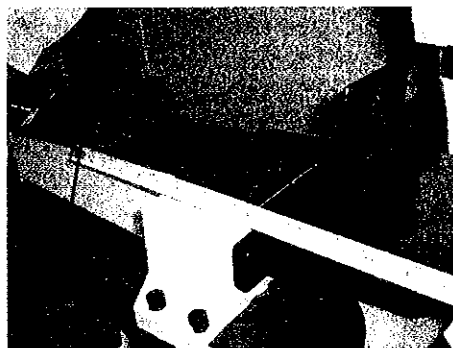


Fig. 3



Fig. 2

## 12. BLADE TRACK ADJUSTMENT

(1). Open the blade guard.

(2). Remove the blade guide assemblies (top and bottom)

(3). Loosen the hex head screw in the tilting mechanism to a point where it is loose but snug.

(4). With the machine running, adjust both the set screw and blade tension knob simultaneously to keep constant tension on the blade. The set screw and blade tension knob are always turned in opposite directions, ie, when one is turned clockwise the other is turned counterclockwise.

The blade is tracking properly when the back side just touches the shoulder of pulley or a slight gap appears near the center line of the pulley. Care should be taken not to over-tighten the saw blade since this will give a false adjustment and limit life of the blade.

(5). Tighten the hex head screw in tilting mechanism. **IMPORTANT:** Sometimes in trying to make this critical adjustment it is possible to cause the basic setting to be misaligned. Should this occur, proceed as follows:

- a. Loosen the set screw and back it out as far as it can go and still remain in the threaded hole.
  - b. Turn the hex head screw clockwise until it stops (do not tighten).
  - c. Turn the set screw clockwise until it bottoms, then continue for half a turn and check the tracking by turning on the machine.
  - d. If further adjustment is required, go back to step 4.
- (6). Turn off power to the machine.
- (7). Replace the blade guide assemblies--it may be necessary to loosen the blade tension slightly.
- (8). Adjust the vertical position of blade guide bearing assemblies so that the back side of the blade just touches the ball bearing.

- (9). Make a final run to check tracking. It required, touch up adjustment (See step 4)
- (10). Replace the blade guards.

### 13. MAINTENANCE

**CAUTION: MAKE CERTAIN THAT THE UNIT IS DISCONNECTED FROM THE POWER SOURCE BEFORE ATTEMPTING TO SERVICE OR REMOVE ANY COMPONENT.**

That's easier to keep machine in good condition or best performance by means of maintaining it at any time than remedy it after it is out of order.

#### (1) Daily Maintenance (by operator)

(a) Fill the lubricant before starting machine everyday.

(b) If the temperature of spindle caused over-heating or strange noise, stop machine immediately to check it for keeping accurate performance.

(c) Keep work area clean; release vise, cutter, work-piece from table; switch off power source; take chip or dust away from machine and follow instructions lubrication or coating rust proof oil before leaving.

#### (2) Weekly Maintenance

(a) Clean and coat the leading screw with oil.

(b) Check to see if sliding surface and turning parts lack of lubricant. If the lubricant is insufficient, fill it.

#### (3) Monthly Maintenance

(a) Check if the fixed portion have been loose.

(b) Lubricate bearing, worm, and worm shaft to avoid the wearing.

#### (4) Yearly Maintenance

(a) Adjust table to horizontal position for maintenance of accuracy.

(b) Check electric cord, plugs, switches at least once a year to avoid loosening or

wearing.

#### 14. LUBRICATION

Lubricate the following components using SAE-30 oil as noted.

- (1). Ball-bearing none.
- (2). Driven pulley bearing 6-8 drops a week.
- (3). Vise lead screw as needed.
- (4). The drive gears run in an oil bath and will not require a lubricant change more often than once a year, unless the lubricant is accidentally contaminated or a

leak occurs because of improper replacement of the gear box cover. During the first few days of operation, the worm gear drive will run hot. Unless the temperature exceeds 200F., there is no cause for alarm.

The following lubricants may be used for the gear box:

Atlantic Refinery Co. Mogul Cyl. Oil

Cities Service Gptimus No. 6

Gulf Refinery Co Medium Gear Oil

Pure oil Co. Park Clipper

#### 15. TROUBLE SHOOTING


| Symptom                  | Possible Cause(s)                                                                                                                                                                                                                                                                                                                                                                                                                          | Corrective Action                                                                                                                                                                                                                                                                                                                                                                                                                                                                                               |
|--------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| Excessive Blade Breakage | <ol style="list-style-type: none"> <li>1. Materials loosen in vise.</li> <li>2. Incorrect speed or feed</li> <li>3. Blade teeth spacing too large</li> <li>4. Material too coarse</li> <li>5. Incorrect blade tension</li> <li>6. Teeth in contact with material before saw is started</li> <li>7. Blade rubs on wheel flange</li> <li>8. Miss-aligned guide bearings</li> <li>9. Blade too thick</li> <li>10. Cracking at weld</li> </ol> | <ol style="list-style-type: none"> <li>1. Clamp work securely</li> <li>2. Adjust speed or feed</li> <li>3. Replace with a small teeth spacing blade</li> <li>4. Use a blade of slow speed and small teeth spacing</li> <li>5. Adjust to where blade just does not slip on wheel</li> <li>6. Place blade in contact with work after motor is started</li> <li>7. Adjust wheel alignment</li> <li>8. Adjust guide bearings</li> <li>9. Use thinner blade</li> <li>10. Weld again, note the weld skill.</li> </ol> |
| Premature Blade Dulling  | <ol style="list-style-type: none"> <li>1. Teeth too coarse</li> <li>2. Too much speed</li> <li>3. Inadequate feed pressure</li> <li>4. Hard spots or scale on material</li> <li>5. Work hardening of material.</li> <li>6. Blade twist</li> <li>7. Insufficient blade</li> <li>8. Blade slide</li> </ol>                                                                                                                                   | <ol style="list-style-type: none"> <li>1. Use finer teeth</li> <li>2. Decrease speed</li> <li>3. Decrease spring tension on side of saw</li> <li>4. Reduce speed, increase feed pressure</li> <li>5. Increase feed pressure by reducing spring tension</li> <li>6. Replace with a new blade, and adjust blade tension</li> <li>7. Tighten blade tension</li> </ol>                                                                                                                                              |

|                                    |                                                                                                                                                                                                                                                                              |                                                                                                                                                                                                                                                                                                                                    |
|------------------------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
|                                    |                                                                                                                                                                                                                                                                              | adjustable knob<br>8. Tighten blade tension                                                                                                                                                                                                                                                                                        |
| Unusual Wear on Side/Back of Blade | 1. Blade guides worn.<br>2. Blade guide bearings not adjust properly<br>3. Blade guide bearing bracket is loose                                                                                                                                                              | 1. Replace.<br>2. Adjust as per operators manual<br>3. Tighten.                                                                                                                                                                                                                                                                    |
| Teeth Ripping from Blade.          | 1. Tooth too coarse for work<br>2. Too heavy pressure; too slow speed.<br>3. Vibrating work-piece.<br>4. Gullets loading                                                                                                                                                     | 1. Use finer tooth blade.<br>2. Decrease pressure, increase speed<br>3. Clamp work piece securely<br>4. Use coarser tooth blade or brush to remove chips.                                                                                                                                                                          |
| Motor running too hot              | 1. Blade tension too high.<br>2. Drive belt tension too high.<br>3. Blade is too coarse for work<br>4. Blade is too fine for work<br>5. Gears aligned improperly<br>6. Gears need lubrication<br>7. Cut is binding blade                                                     | 1. Reduce tension on blade.<br>2. Reduce tension on drive belt.<br>3. Use finer blade.<br>4. Use coarse blade.<br>5. Adjust gears so that worm is in center of gear.<br>6. Check oil path.<br>7. Decrease reed anti speed                                                                                                          |
| Bad Cuts (Crooked)                 | 1. Feed pressure too great.<br>2. Guide bearings not adjusted properly.<br>3. Inadequate blade tension.<br>4. Dull blade.<br>5. Speed incorrect.<br>6. Blade guides spaced out too much.<br>7. Blade guide assembly loose<br>8. Blade truck too far away from wheel flanges. | 1. Reduce pressure by increasing spring tension on side of saw<br>2. Adjust guide bearing, the clearance cannot greater than 0.001.<br>3. Increase blade tension by adjust blade tension<br>4. Replace blade<br>5. Adjust speed<br>6. Adjust guides space.<br>7. Tighten<br>8. Re-track blade according to operating instructions. |
| Bad Cuts (Rough)                   | 1. Too much speed or feed.<br>2. Blade is too coarse.<br>3. Blade tension loose.                                                                                                                                                                                             | 1. Decrease speed or feed.<br>2. Replace with finer blade.<br>3. Adjust blade tension.                                                                                                                                                                                                                                             |
| Blade is twisting                  | 1. Cut is binding blade.<br>2. Too much blade tension.                                                                                                                                                                                                                       | 1. Decrease reed pressure.<br>2. Decrease blade tension.                                                                                                                                                                                                                                                                           |

16.WIRING DIAGRAM

WIRING DIAGRAM  
TOGGLE SWITCH SINGLE PHASE



712N

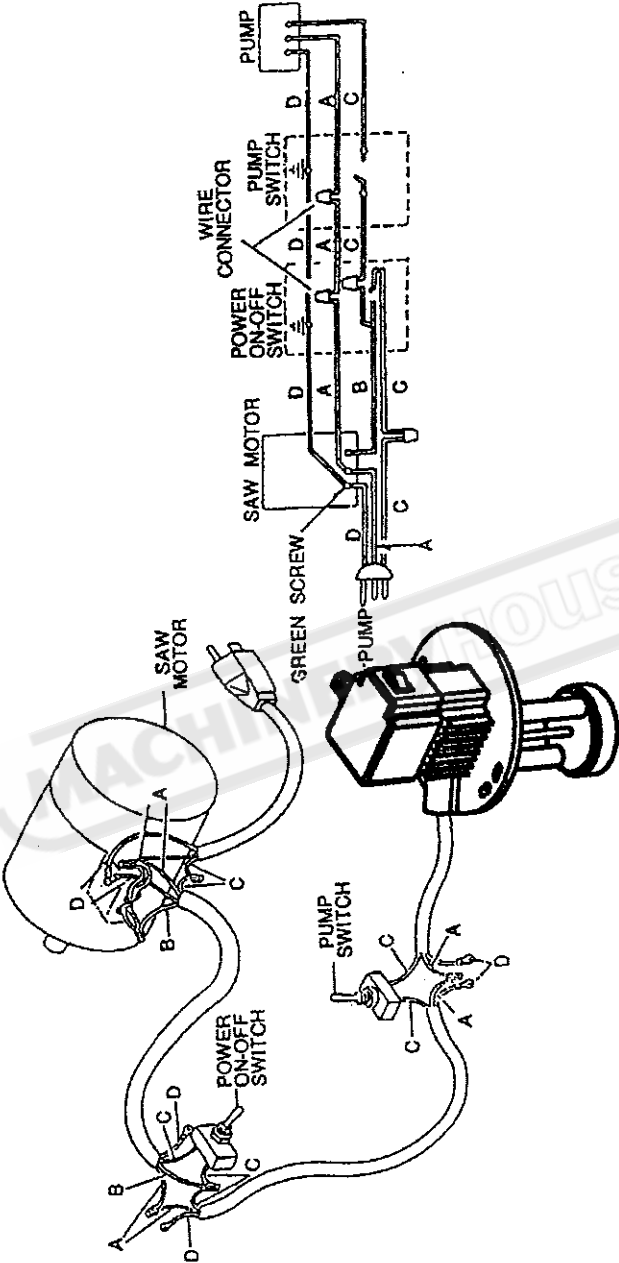


| COLOR | REF NO. | A     | B     | C     | D            |
|-------|---------|-------|-------|-------|--------------|
| HZ    |         |       |       |       |              |
|       | 50      | BLUE  | BLACK | BROWN | YELLOW GREEN |
|       | 60      | WHITE | RED   | BLACK | GREEN        |






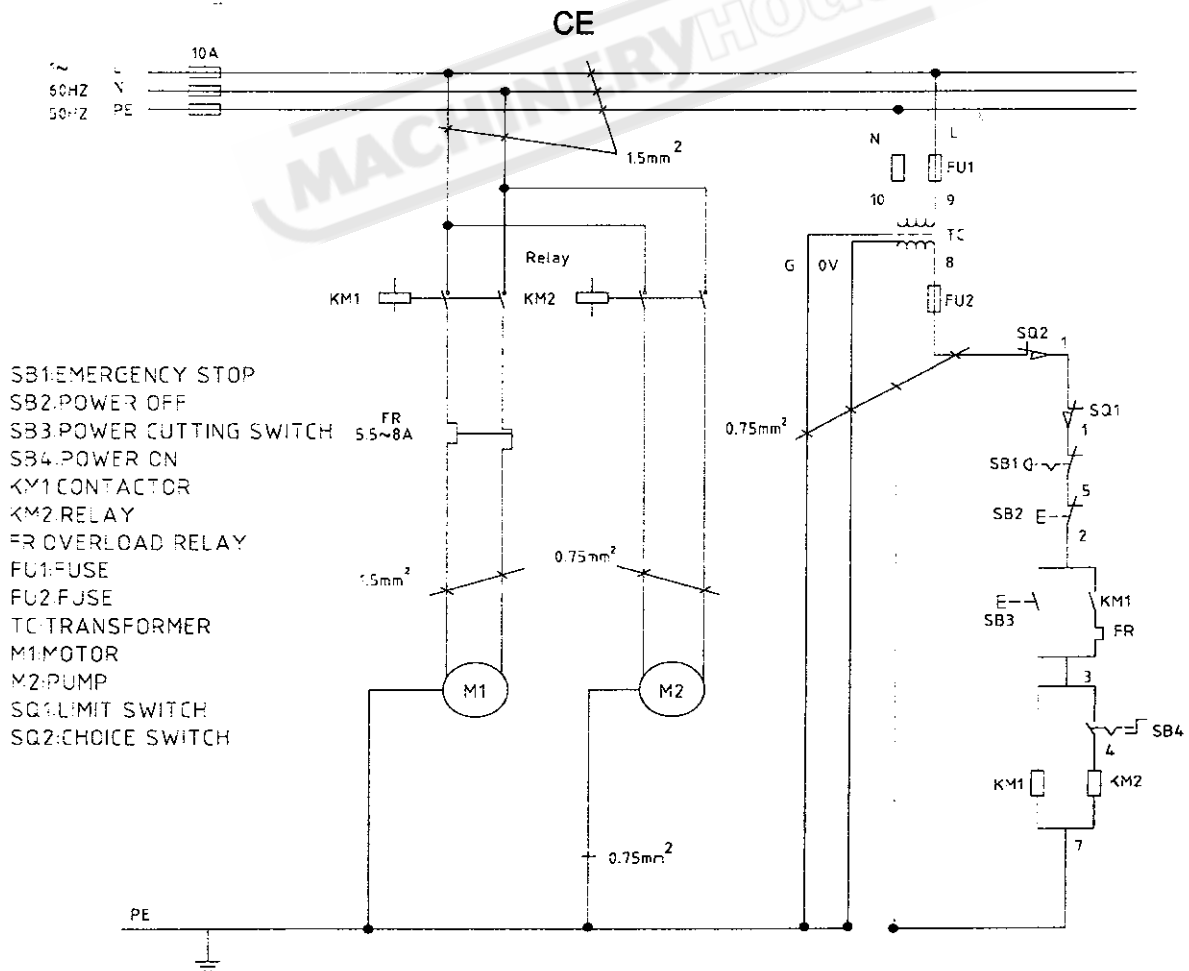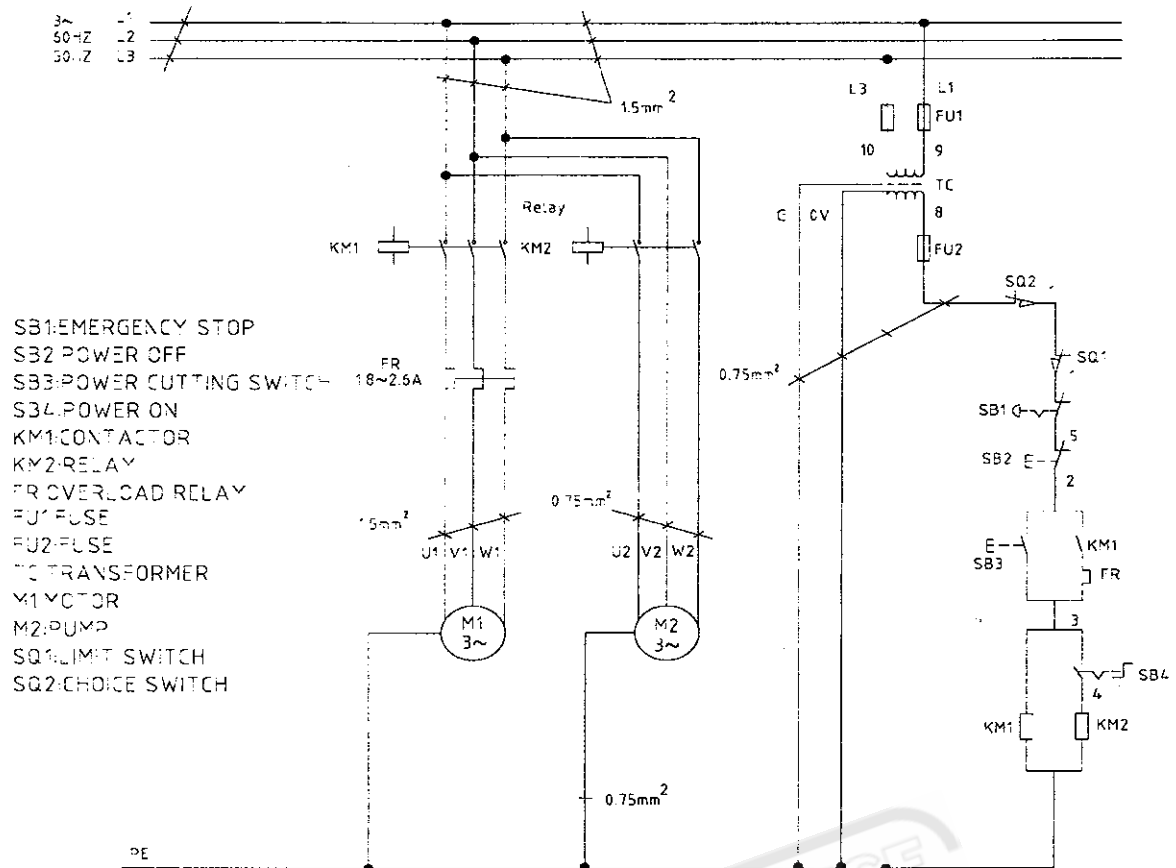

CE

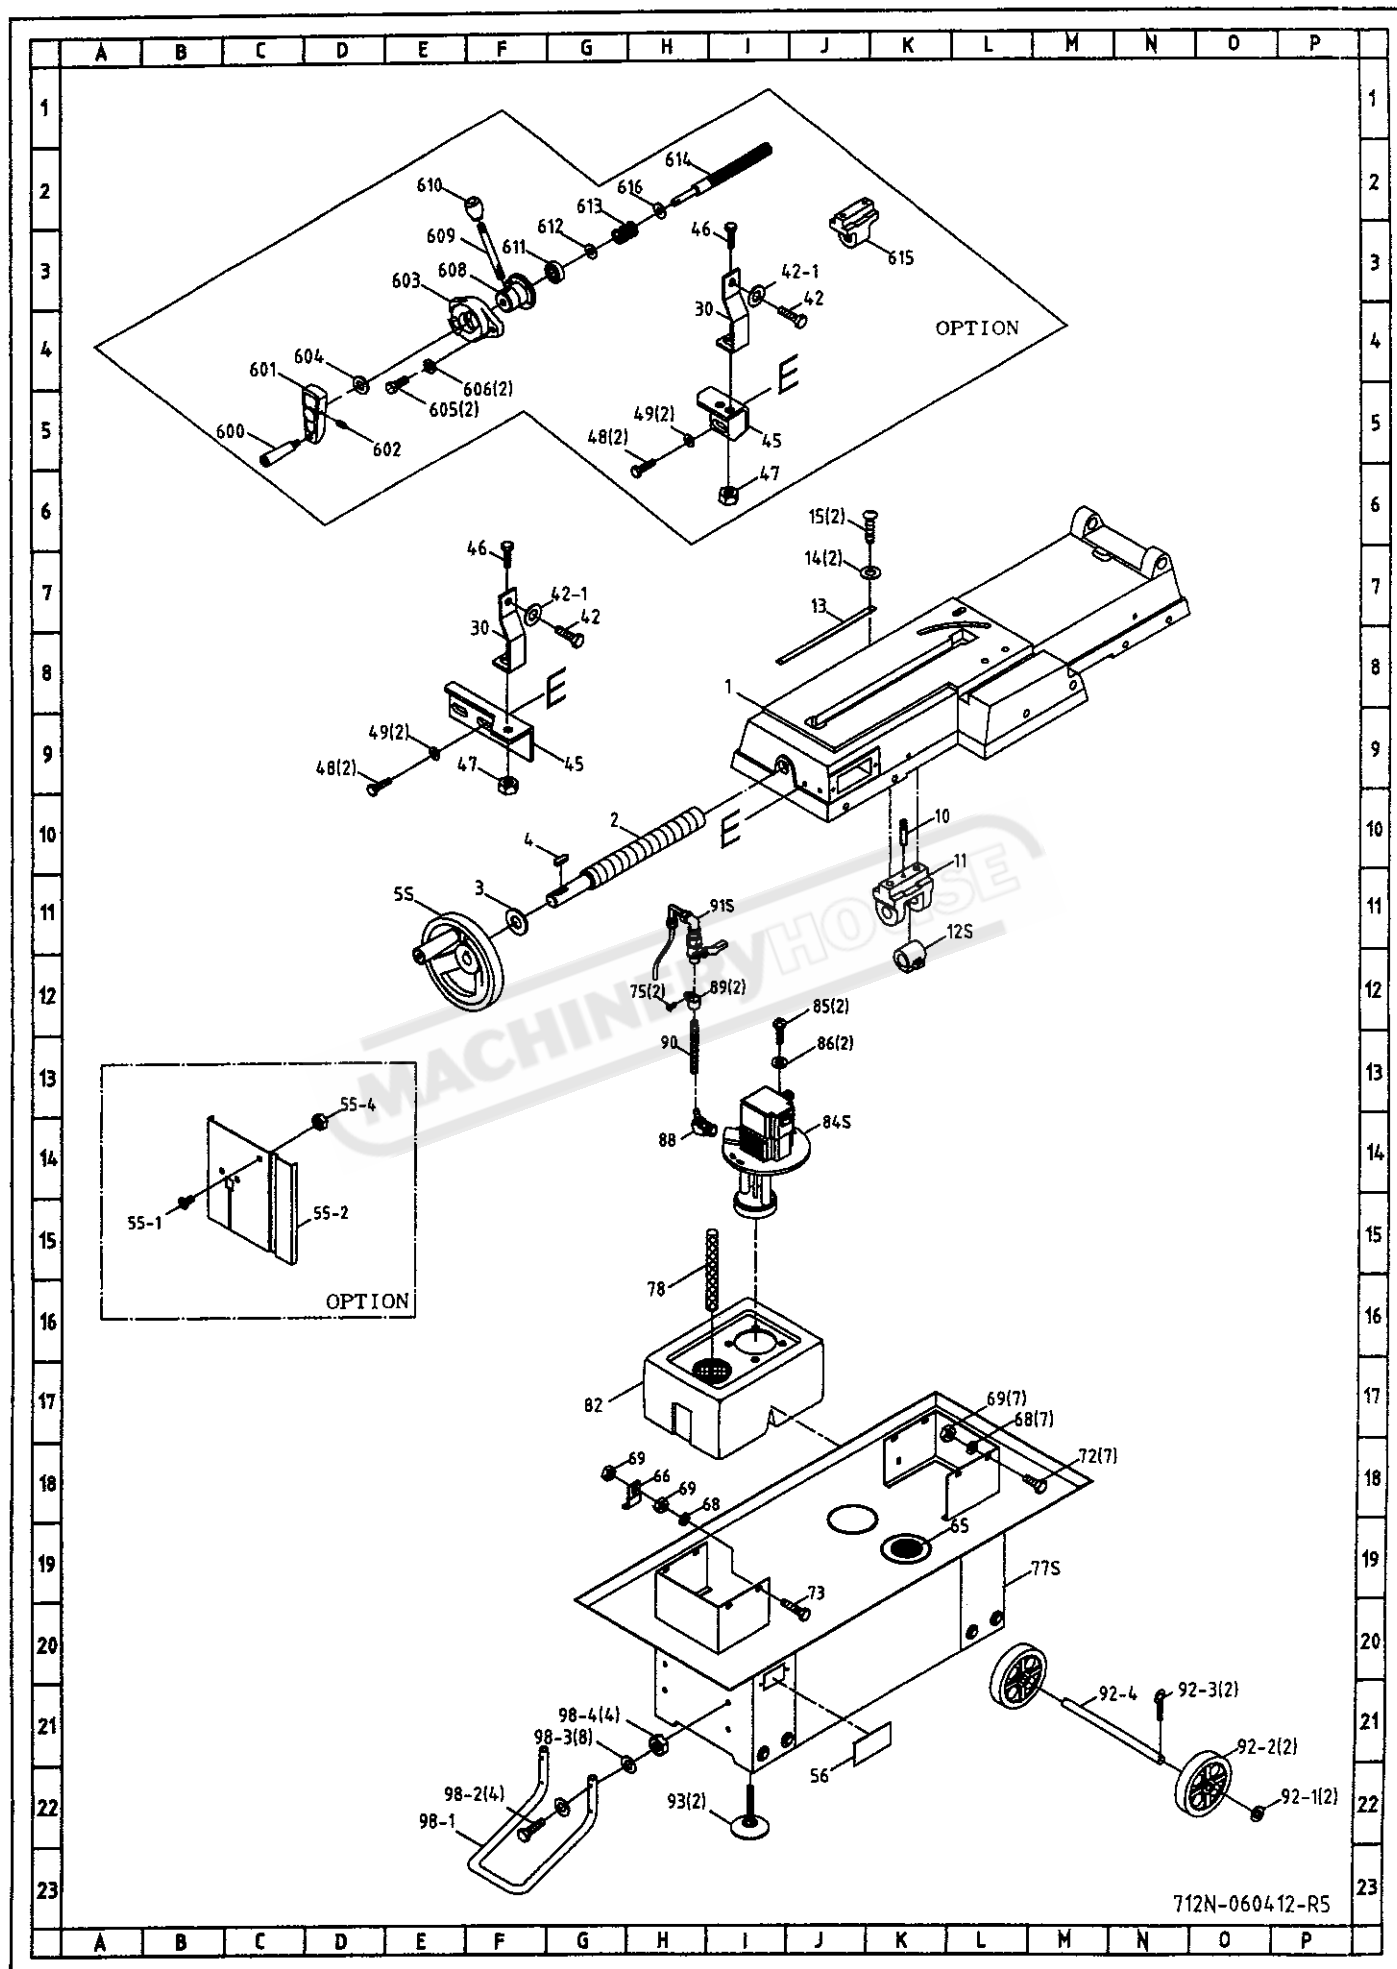



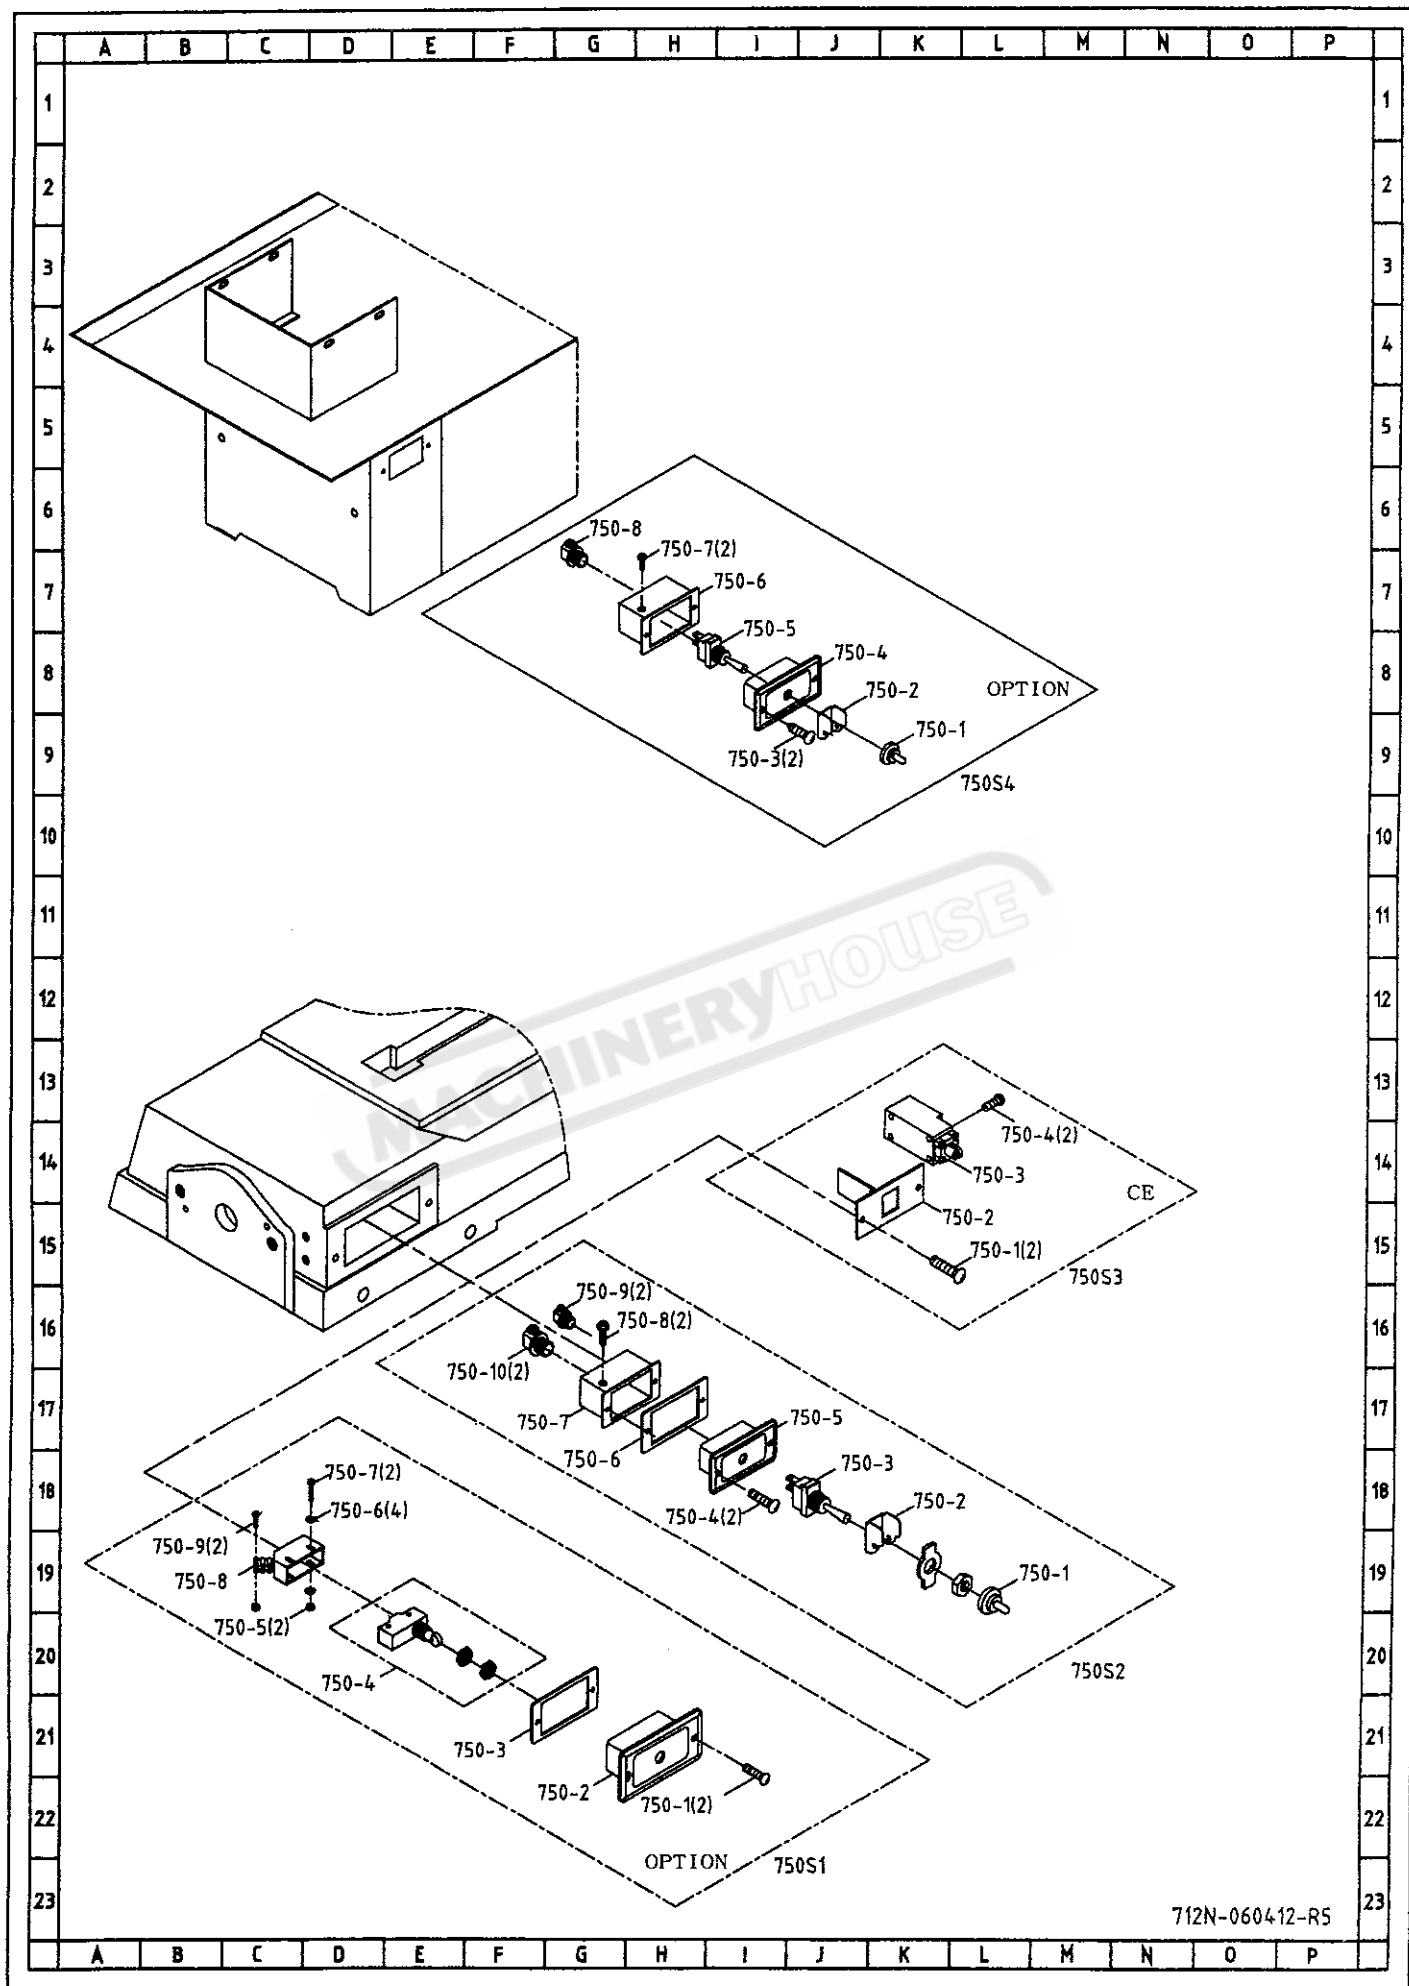

## PARTS LIST

MODEL NO. 712N G0561

| CODE NO | PART NO  | DESCRIPTION             | SPECIFICATION | QTY | NOTE        |
|---------|----------|-------------------------|---------------|-----|-------------|
| 1       | 181107A  | Swivel Base             |               | 1   | All thread  |
| 1       | 181107-2 | Base                    |               | 1   | Semi thread |
| 2       | 181108E  | Acme Screw              |               | 1   |             |
| 3       | W002     | Washer                  | 1/2"x28xt2    | 1   |             |
| 4       | K003     | Key                     | 5x5x15L       | 1   |             |
| 5S      | 181606S  | Wheel                   |               | 1   |             |
| 7       | 181266   | Fixed Bolt              |               | 1   |             |
| 8       | W008     | Washer                  | 3/8"x25xt2    | 2   |             |
| 9       | 181114   | Vise Jaw Bracket(Front) |               | 1   |             |
| 10      | HP021    | Pin                     | 5x35L         | 1   | Semi thread |
| 11      | 181136A  | Bracket                 |               | 1   | Semi thread |
| 12S     | 181604S  | Acme Nut Assembly       |               | 1   | Semi thread |
| 13      | 181012   | Scale                   |               | 1   |             |
| 14      | W007     | Washer                  | 3/16"x12xt0.8 | 2   |             |
| 15      | S708     | Cross Round Head Screw  | 3/16"x3/8"L   | 2   |             |
| 16      | ET2108   | Wire Nipple             | 5/8"          | 1   |             |
| 17      | S501     | Carriage Screw          | 1/2"x2"L      | 1   |             |
| 18      | N001     | Hex. Nut                | 1/2"          | 1   |             |
| 19      | W002     | Washer                  | 1/2"x28xt2    | 2   |             |
| 20      | S012     | Hex. Head Screw         | 3/8"x1-1/2"L  | 1   |             |
| 21      | S003     | Hex. Head Screw         | 1/2"x2"L      | 1   |             |
| 22      | 181113-4 | Vise Jaw Bracket(Rear)  |               | 1   |             |
| 23      | 181121   | Bushing                 |               | 1   |             |
| 24      | 181122-1 | Support Rod             |               | 1   |             |
| 25      | S063     | Screw                   | 5/16"x3/4"L   | 1   |             |
| 26      | 181123   | Pivot Bracket           |               | 1   |             |
| 27      | 181270   | Washer                  |               | 1   |             |
| 28      | S012     | Hex. Head Screw         | 3/8"x1-1/2"L  | 2   |             |
| 29      | 181133   | Support Plate           |               | 1   |             |
| 30      | 181134   | Fixed Plate             |               | 1   |             |
| 31      | 181117-1 | Spring                  |               | 1   |             |
| 32      | 181118   | Spring Adjusting Rod    |               | 1   |             |
| 33      | 181115   | Spring Handle Bracket   |               | 1   |             |
| 34      | S022     | Hex. Head Screw         | 5/16"x3/4"L   | 1   |             |
| 35      | W016     | Washer                  | 5/16"x23xt2   | 1   |             |
| 35-1    | N007     | Hex. Nut                | 5/16"         | 1   |             |
| 36      | N005     | Hex. Nut                | 3/8"          | 1   |             |
| 37      | W014     | Washer                  | 3/8"x23xt2    | 1   |             |
| 38      | 181130   | Thumb Screw             |               | 1   |             |

## PARTS LIST

MODEL NO. 712N G0561

| CODE NO | PART NO | DESCRIPTION             | SPECIFICATION | QTY | NOTE        |
|---------|---------|-------------------------|---------------|-----|-------------|
| 39      | S022    | Hex. Head Screw         | 5/16"x3/4"L   | 1   |             |
| 40      | 3021    | Stock Stop Rod          |               | 1   |             |
| 41      | 181125  | Stop Block              |               | 1   |             |
| 42      | S019    | Hex. Head Screw         | 5/16"x1-1/2"L | 1   |             |
| 42-1    | W004    | Washer                  | 1/4"x19xt1.5  | 1   |             |
| 45      | 181112  | Support Plate           |               | 1   | Semi thread |
| 45      | 181112A | Support Plate           |               | 1   | All thread  |
| 46      | S014    | Hex. Head Screw         | 3/8"x1-3/4"L  | 1   |             |
| 47      | N005    | Hex. Nut                | 3/8"          | 1   |             |
| 48      | S022    | Hex. Head Screw         | 5/16"x3/4"L   | 2   |             |
| 49      | W017    | Washer                  | 5/16"x18xt1.5 | 2   |             |
| 50      | S014    | Hex. Head Screw         | 3/8"x1-3/4"L  | 1   |             |
| 51      | N005    | Hex. Nut                | 3/8"          | 1   |             |
| 52      | S022    | Hex. Head Screw         | 5/16"x3/4"L   | 2   |             |
| 53      | W017    | Washer                  | 5/16"x18xt1.5 | 2   |             |
| 55-1    | S302    | Flat Cross Head Screw   | 1/4"x3/8"L    | 1   | Option      |
| 55-2    | 3055A   | Vertical Saw Table      |               | 1   | Option      |
| 55-4    | N003    | Hexagon nut             | 1/4"          | 1   | Option      |
| 56      | 181900  | Warning mark            |               | 1   |             |
| 65      | 191106A | Filter                  |               | 1   |             |
| 66      | 3076    | Switch Cut Off Tip      |               | 1   |             |
| 68      | W017    | Washer                  | 3/8"x18xt1.5  | 8   |             |
| 69      | N007    | Hex. Nut                | 5/16"         | 9   |             |
| 72      | S017    | Hex. Head Screw         | 5/16"x1"L     | 7   |             |
| 73      | S023    | Hex. Head Screw         | 5/16"x1-1/4"L | 1   |             |
| 75      | S708    | Cross Round Head Screw  | 3/16"x3/8"L   | 2   |             |
| 77S     | 18110   | Stand Complete Assembly |               | 1   |             |
| 78      | 181854  | Hose                    | 5/8"x200mm    | 1   |             |
| 82      | 181256  | Coolant Tank            |               | 1   |             |
| 84S     |         | Pump                    |               | 1   |             |
| 85      | S717    | Cross Round Head Screw  | 1/4"x5/8"L    | 2   |             |
| 86      | W004    | Washer                  | 1/4"x19xt1.5  | 2   |             |
| 88      | 181852  | Coupler                 | 3/8"PTx5/16"  | 1   |             |
| 89      | 181601  | Hose Clip               | 5/8"          | 2   |             |
| 90      | 181981  | Hose                    | OD12xID8x2000 | 1   |             |
| 91S     | 181980  | Fitting                 |               | 1   |             |
| 92-1    | W013    | Washer                  | 3/8"          | 2   |             |
| 92-2    | 181129  | Wheel                   |               | 2   |             |
| 92-3    | HP210   | Cotter Pin              | ⌀ 3x25L       | 2   |             |

## PARTS LIST

MODEL NO. 712N G0561

| CODE NO | PART NO   | DESCRIPTION                | SPECIFICATION | QTY | NOTE                 |
|---------|-----------|----------------------------|---------------|-----|----------------------|
| 92-4    | 181128    | Wheel Rod                  |               | 1   |                      |
| 93      | 181308    | Coaster of Stand           |               | 2   |                      |
| 98-1    | 192039    | Hand Rod                   |               | 1   |                      |
| 98-2    | S019      | Hex. Head Screw            | 5/16"x1-1/2"L | 4   |                      |
| 98-3    | W017      | Washer                     | 5/16"x18xt1.5 | 8   |                      |
| 98-4    | N007      | Hex. Nut                   | 5/16"         | 4   |                      |
| 130     | 181306    | Bracket                    |               | 1   | For CE Only          |
| 130     | 181306A   | Bracket                    |               | 1   | For CE Only (Option) |
| 131     | HS508     | Cross Round Head Screw     | M4x5L         | 4   | For CE Only          |
| 132     | 181305    | Switch Base                |               | 1   | For CE Only          |
| 132     | 181305A   | Switch base                |               | 1   | For CE Only (Option) |
| 133     | HW003     | Washer                     | M5            | 2   | For CE Only          |
| 134     | HW509     | Cross Round Head Screw     | M4x10L        | 2   | For CE Only          |
| 135     | W018      | Washer                     | 5/16"x23xt3   | 1   |                      |
| 136     | S022      | Hex. Head Screw            | 5/16"x3/4"L   | 1   |                      |
| 139     | 181608    | Washer                     |               | 1   |                      |
| 140     | 181301C   | Cylinder Lower Support     |               | 1   |                      |
| 141     | W016      | Washer                     | 5/16"x19xt1.5 | 1   |                      |
| 142     | S018      | Hex. Head Screw            | 5/16"x1/2"L   | 1   |                      |
| 201S    | 18121     | Gear Box Assembly          |               | 1   |                      |
| 202S    | 18138     | Worm Gear Shaft Assembly   |               | 1   |                      |
| 203     | HK110     | Key                        | 5x5x30L       | 1   |                      |
| 206     | 181226    | Spindle Pulley             |               | 1   |                      |
| 207     | S604      | Hex. Socker Headless Screw | 1/4"x3/8"L    | 2   |                      |
| 208     | 181874    | Belt                       | 3Vx270        | 1   |                      |
| 209     | 181237D   | Cover                      |               | 1   |                      |
| 210     | N005      | Hex. Nut                   | 3/8"          | 1   |                      |
| 211     | W013      | Washer                     | 3/8"x20xt2    | 1   |                      |
| 212     | 181302-2  | Cylinder Upper Support     |               | 1   |                      |
| 213     | W017      | Washer                     | 5/16"x18xt1.5 | 3   |                      |
| 214     | S017      | Hex. Head Screw            | 5/16"x1"L     | 3   |                      |
| 215     | W014      | Washer                     | 3/8"x23xt2    | 2   |                      |
| 216     | 181304-2  | Cylinder Complete Set      | RF-712N       | 1   |                      |
| 217     | S412      | Hex. Socket Head Screw     | 3/8"x2-1/4"L  | 1   |                      |
| 218     | 181203-1  | Body Frame                 |               | 1   |                      |
| 219     | W204      | Spring Washer              | 3/8"          | 4   |                      |
| 220     | S013      | Hex. Head Screw            | 3/8"x1-1/4"L  | 4   |                      |
| 230     | HCS13     | C-Retainer Ring            | S25           | 1   |                      |
| 231S    | 181214-2S | Drive Wheel                |               | 1   |                      |

## PARTS LIST

MODEL NO. 712N G0561

| CODE NO | PART NO  | DESCRIPTION                        | SPECIFICATION         | QTY | NOTE   |
|---------|----------|------------------------------------|-----------------------|-----|--------|
| 232     | HK025    | Key                                | 6x6x20L               | 1   |        |
| 233     | S022     | Hex. Head Screw                    | 5/16"x3/4"L           | 1   |        |
| 234     | S201     | Cross Socker Hex. Head Screw       | 1/4"x5/8"L            | 2   |        |
| 235     | W005     | Washer                             | 1/4"x16xt1.5          | 2   |        |
| 236     | 181232-1 | Support Plate                      |                       | 1   |        |
| 237     | 181210   | Sliding Plate                      |                       | 2   |        |
| 238     | 181211   | Blade Tension Sliding Block        |                       | 1   |        |
| 239     | S608     | Hex. Socker Headless Screw         | 5/16"x3/4"L           | 1   |        |
| 240     | S019     | Hex. Head Screw                    | 5/16"x1-1/2"L         | 2   |        |
| 241     | W015     | Washer                             | 5/16"x12xt2           | 2   |        |
| 242     | W205     | Spring Washer                      | 5/16"                 | 4   |        |
| 243     | S020     | Hex. Head Screw                    | 5/16"x3/4"L           | 4   |        |
| 244     | 181212   | Spring                             |                       | 1   |        |
| 245     | 181213A  | Blade Adjustable Knob              |                       | 1   |        |
| 246     | W008     | Washer                             | 3/8"x25xt2            | 1   |        |
| 249S    | 18122    | Shaft Assembly                     |                       | 1   |        |
| 250S    | 18123A   | Idler Wheel Assembly               |                       | 1   |        |
| 251     | 181894   | Blade                              | 0.032"x3/4"x93"x6-10T | 1   |        |
| 251     | 181894-2 | Blade                              | 0.032"x3/4"x93"x6-10T | 1   | Option |
| 252     | 181240   | Switch Cut Off Tip                 |                       | 1   |        |
| 253     | W005     | Washer                             | 1/4"x16xt1.5          | 1   |        |
| 254     | S201     | Cross Socker Hex. Head Screw       | 1/4"x5/8"L            | 1   |        |
| 255     | S013     | Hex. Head Screw                    | 3/8"x1-1/4"L          | 1   |        |
| 256     | W008     | Washer                             | 3/8"x25xt2            | 1   |        |
| 258S    | 181242BS | Brush Assembly                     |                       | 1   |        |
| 259     | S708     | Cross Round Head Screw             | 3/16"x3/8"L           | 2   |        |
| 261     | 3066-3   | Blade Adjustable Knob              |                       | 1   |        |
| 262     | W008     | Washer                             | 3/8"x25xt2            | 1   |        |
| 266S    | 18128A   | Adjustable Bracket Assembly (Rear) |                       | 1   |        |
| 267S    | 18126    | Guide Pivot Assembly               |                       | 1   |        |
| 268S    | 18127    | Bearing Shaft Assembly             |                       | 1   |        |
| 269S    | 18124K   | Adjustable Bracket (Front)         |                       | 1   |        |
| 270S    | 18126    | Guide Pivot Assembly               |                       | 1   |        |
| 271S    | 18127    | Bearing Shaft Assembly             |                       | 1   |        |
| 279     | 181231   | Blade Cover(Front)                 |                       | 1   |        |
| 280     | S711     | Cross Round Head Screw             | 5/32"x1/4"L           | 2   |        |
| 284     | 195083   | Plum handle                        |                       | 2   |        |
| 285     | W005     | Washer                             | 1/4"x16xt1.5          | 2   |        |
| 286S    | 18137    | Blade Back Cover                   |                       | 1   |        |

## PARTS LIST

MODEL NO. 712N G0561

| CODE NO | PART NO | DESCRIPTION                  | SPECIFICATION | QTY | NOTE                 |
|---------|---------|------------------------------|---------------|-----|----------------------|
| 288     | W005    | Washer                       | 1/4"x16xt1.5  | 4   |                      |
| 289     | S701    | Cross Round Head Screw       | 1/4"x1/2"L    | 4   |                      |
| 290     | S201    | Cross Socker Hex. Head Screw | 1/4"x1/2"L    | 1   | For CE Only          |
| 290     | 3058    | Plum handle                  |               | 1   |                      |
| 291     | 181237I | Motor Pulley Cover           |               | 1   |                      |
| 291     | 18131   | Motor Pulley Cover           |               | 1   | For CE Only          |
| 293     | S201    | Cross Socker Hex. Head Screw | 1/4"x5/8"L    | 2   |                      |
| 294     | W004    | Washer                       | 1/4"x19xt1.5  | 2   |                      |
| 295     | HK110   | Key                          | 5x5x30L       | 1   |                      |
| 296     | 181235  | Motor Pulley                 |               | 1   |                      |
| 297     | S604    | Hex. Socker Headless Screw   | 1/4"x3/8"L    | 1   |                      |
| 298     | S510    | Carriage Screw               | 5/16"x3/4"L   | 4   |                      |
| 300     |         | Motor                        |               | 1   |                      |
| 301     | S017    | Hex. Head Screw              | 5/16"x1"L     | 2   |                      |
| 302     | N007    | Hex. Nut                     | 5/16"         | 2   |                      |
| 303     | 181234A | Motor Mount Plate            |               | 1   |                      |
| 304     | N007    | Hex. Nut                     | 5/16"         | 4   |                      |
| 305     | S022    | Hex. Head Screw              | 5/16"x3/4"L   | 4   |                      |
| 306     | W016    | Washer                       | 5/16"x23xt2   | 12  |                      |
| 307     | 181233A | Motor Mount Bracket          |               | 1   |                      |
| 307-1   | W016    | Washer                       | 5/16"X23Xt2   | 2   |                      |
| 307-2   | S020    | Hex. Head Screw              | 5/16"X7/8"L   | 2   |                      |
| 343     | W005    | Washer                       | 1/4"x16xt1.5  | 1   | For CE Only          |
| 345     | 181991  | Emergency Switch Bracket     |               | 1   | For CE Only          |
| 345     | 181991A | Emergency Switch Bracket     |               | 1   | For CE Only (Option) |
| 348     | S727    | Cross Round Head Screw       | M6x12L        | 4   | For CE Only          |
| 351     | S407    | Hex. Socket Head Screw       | 3/16"x3/8"L   | 2   | For CE Only          |
| 600     | 3027-1  | Knob                         |               | 1   | All thread           |
| 601     | 193057  | Knob                         |               | 1   | All thread           |
| 602     | S601    | Hex. Socker Headless Screw   | 1/4"x1/2"L    | 1   | All thread           |
| 603     | 193055  | Pressure Lump                |               | 1   | All thread           |
| 604     | HW007   | Washer                       | φ 12xt2       | 1   | All thread           |
| 605     | S013    | Hex. Head Screw              | 3/8"x1-1/4"L  | 2   | All thread           |
| 606     | W013    | Washer                       | 3/8"x20xt2    | 2   | All thread           |
| 608     | 193056  | Pressure Shaft               |               | 1   | All thread           |
| 609     | 193059  | Knob W/Shaft                 |               | 1   | All thread           |
| 610     | 290086  | Plastic Round Knob           | RF31\         | 1   | All thread           |
| 611     | CA51101 | Bearing                      |               | 1   | All thread           |
| 612     | HW007   | Washer                       | φ 12xt2       | 1   | All thread           |

## PARTS LIST

MODEL NO. 712N G0561


| CODE NO | PART NO  | DESCRIPTION            | SPECIFICATION | QTY | NOTE        |
|---------|----------|------------------------|---------------|-----|-------------|
| 613     | 193058   | Spring                 |               | 1   | All thread  |
| 614     | 181108C  | Acme Screw             |               | 1   | All thread  |
| 615     | 181138B  | Acme Nut               |               | 1   | All thread  |
| 616     | W002     | Washer                 | 1/2"x28x12    | 1   | All thread  |
| 750S1   | ET1615S  | Limit Switch Assembly  |               | 1   | Option      |
| 750-1   | S708     | Cross Round Head Screw | 3/16"x3/8"L   | 2   | Option      |
| 750-2   | ET1931   | Switch Cover           |               | 1   | Option      |
| 750-3   | 181431   | Rubber Plate           |               | 1   | Option      |
| 750-4   | ET1615   | Limit Switch           | MJ1308R       | 1   | Option      |
| 750-5   | HN002    | Hex. Nut               | M4            | 2   | Option      |
| 750-6   | HW305    | Star Washer            | M4            | 4   | Option      |
| 750-7   | HS513    | Cross Round Head Screw | M4x30L        | 2   | Option      |
| 750-8   | ET2101   | Limit Switch Cover     | CB2           | 1   | Option      |
| 750-9   | HS511    | Cross Round Head Screw | M4x20L        | 2   | Option      |
| 750S2   | ET1403S  | Toggle Switch Assembly |               | 1   |             |
| 750-1   | 181932   | Toggel Switch Cover    |               | 1   |             |
| 750-2   | 3131B    | Switch Cover           |               | 1   |             |
| 750-3   | ET1403   | Toggle Switch Assembly | 1 \$          | 1   |             |
| 750-3   | 181933   | Toggle Switch          | 3 \$          | 1   |             |
| 750-4   | S805     | Screw                  | 3/16"x3/8"L   | 2   |             |
| 750-5   | ET1931   | Cover                  |               | 1   |             |
| 750-6   | 181431   | Rubber Plate           |               | 1   |             |
| 750-7   | ET1930   | Electrical Box         |               | 1   |             |
| 750-8   | S807     | Screw                  | 5/32"x1/8"L   | 2   |             |
| 750-9   | ET2108   | Wire Nipple            | 5/8"          | 2   |             |
| 750-10  | ET2107   | Wire Nipple            | 1/2"          | 2   |             |
| 750S3   | ET1617S  | Switch                 |               | 1   | For CE Only |
| 750-1   | S708     | Cross Round Head Screw | 3/16"x3/8"L   | 2   | For CE Only |
| 750-2   | 181989-1 | Switch Bracket         |               | 1   | For CE Only |
| 750-3   | ET1617   | Switch                 |               | 1   | For CE Only |
| 750-4   | S708     | Cross Round Head Screw | 3/16"x3/8"L   | 2   | For CE Only |
| 750S4   | ET1401S  | Toggle Switch Assembly |               | 1   | Option      |
| 750-1   | 181932   | Toggel Switch Cover    |               | 1   | Option      |
| 750-2   | 3131B    | Switch Cover           |               | 1   | Option      |
| 750-3   | S805     | Screw                  | 3/16"x3/8"L   | 2   | Option      |
| 750-4   | ET1931   | Cover                  |               | 1   | Option      |
| 750-5   | ET1401   | Toggle Switch Assembly | 1 \$          | 1   | Option      |
| 750-5   | 181933   | Toggle Switch Assembly | 3 \$          | 1   | Option      |
| 750-6   | ET1930   | Electrical Box         |               | 1   | Option      |

## PARTS LIST


MODEL NO. 712N G0561

| CODE NO | PART NO | DESCRIPTION | SPECIFICATION | QTY | NOTE   |
|---------|---------|-------------|---------------|-----|--------|
| 750-7   | S807    | Screw       | 5/32"x1/8"L   | 2   | Option |
| 750-8   | ET2107  | Wire Nipple | 1/2"          | 1   | Option |

MACHINERYHOUSE

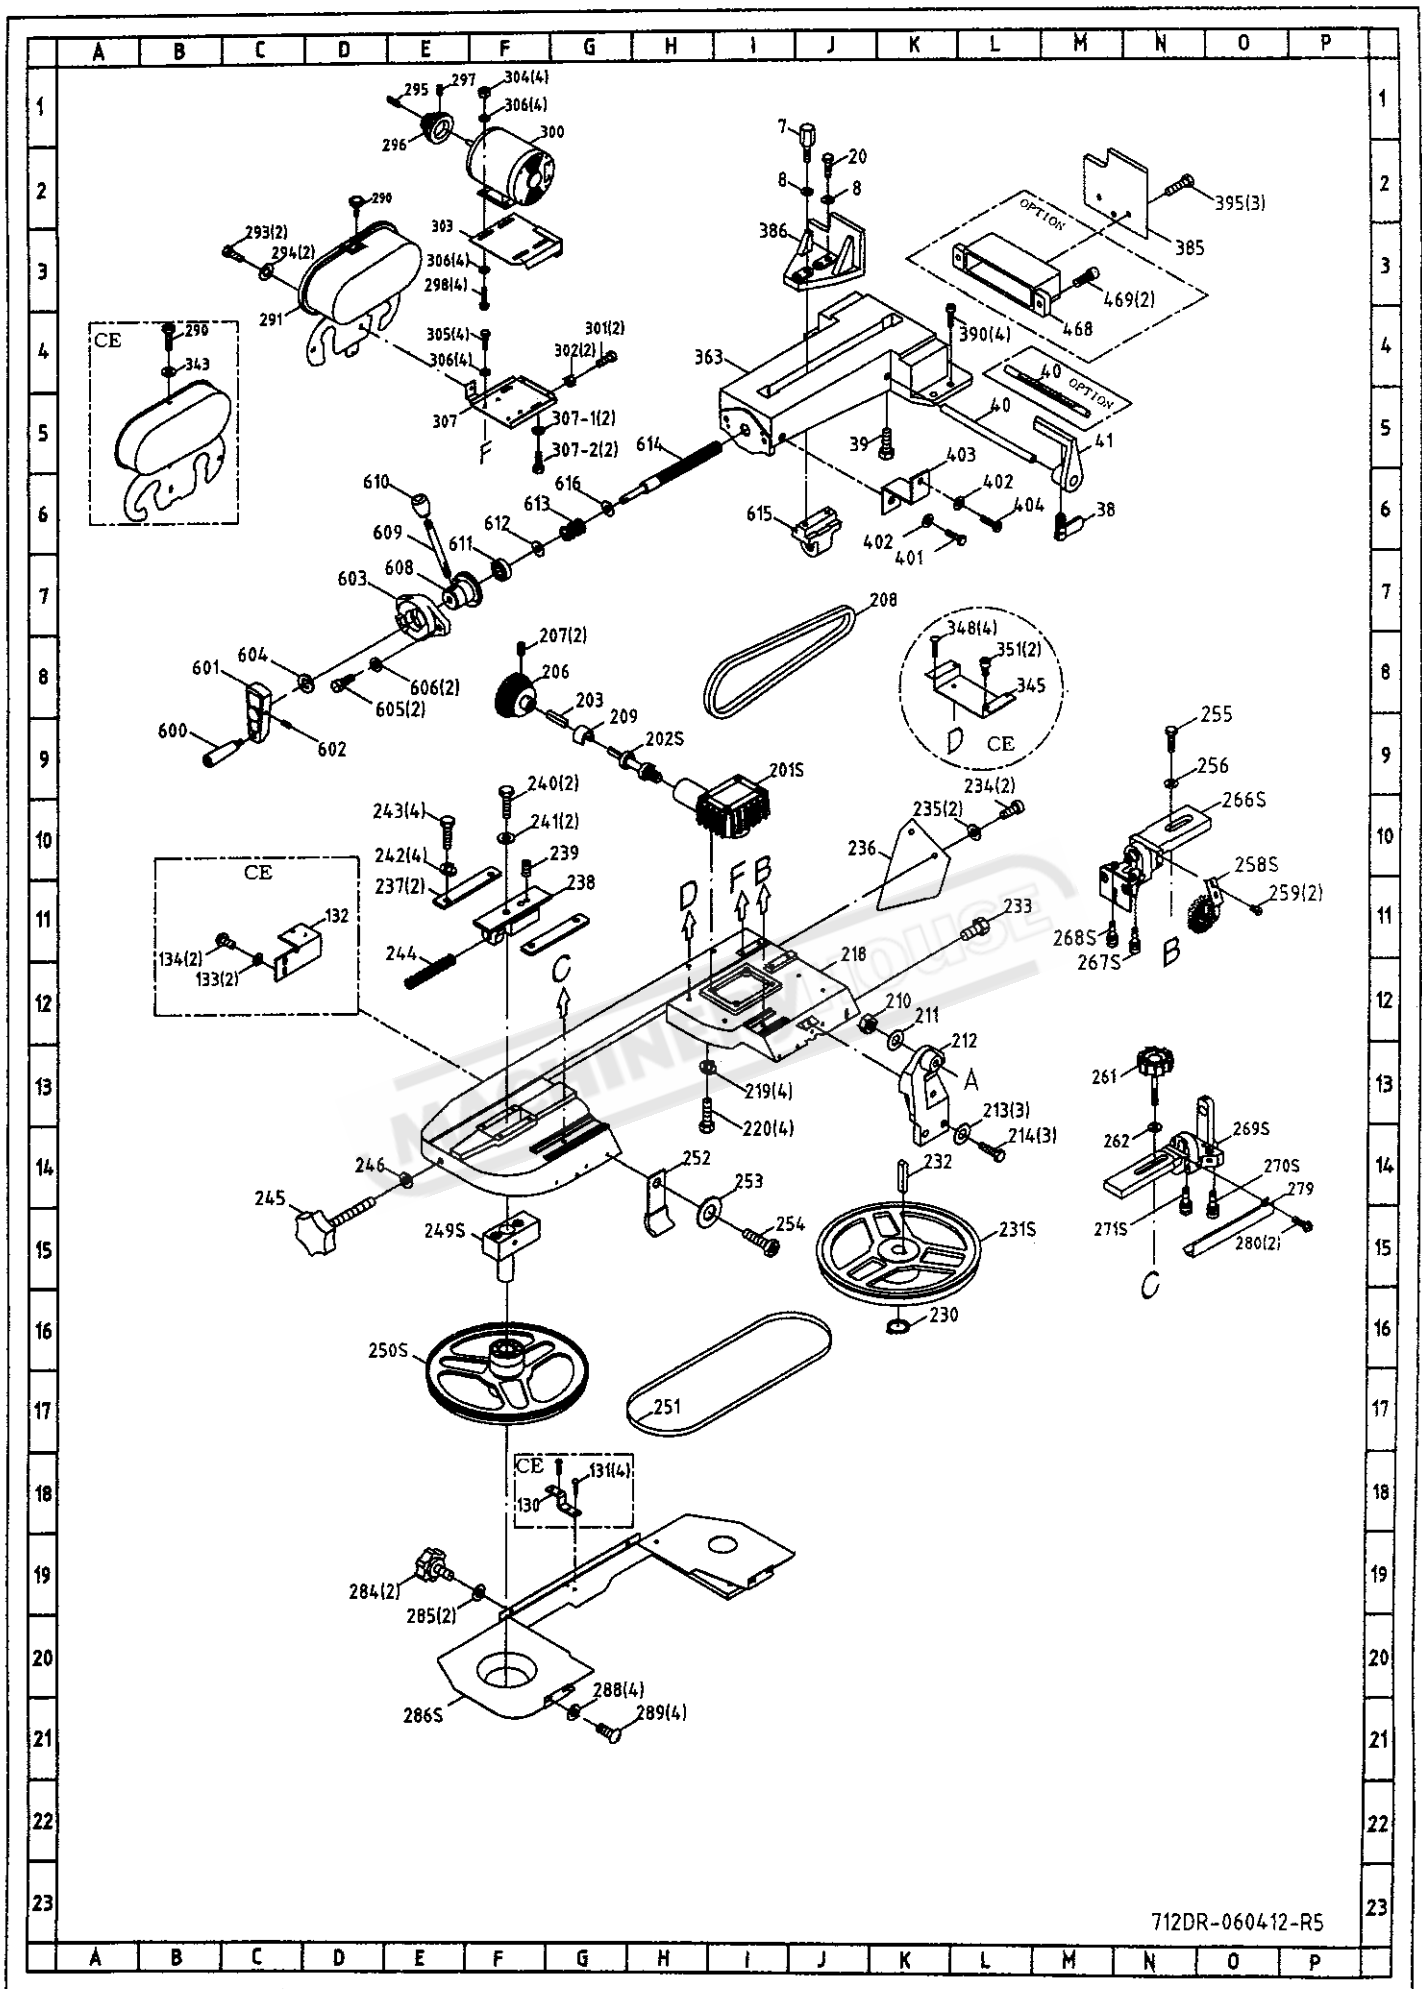

712DR-060412-R5

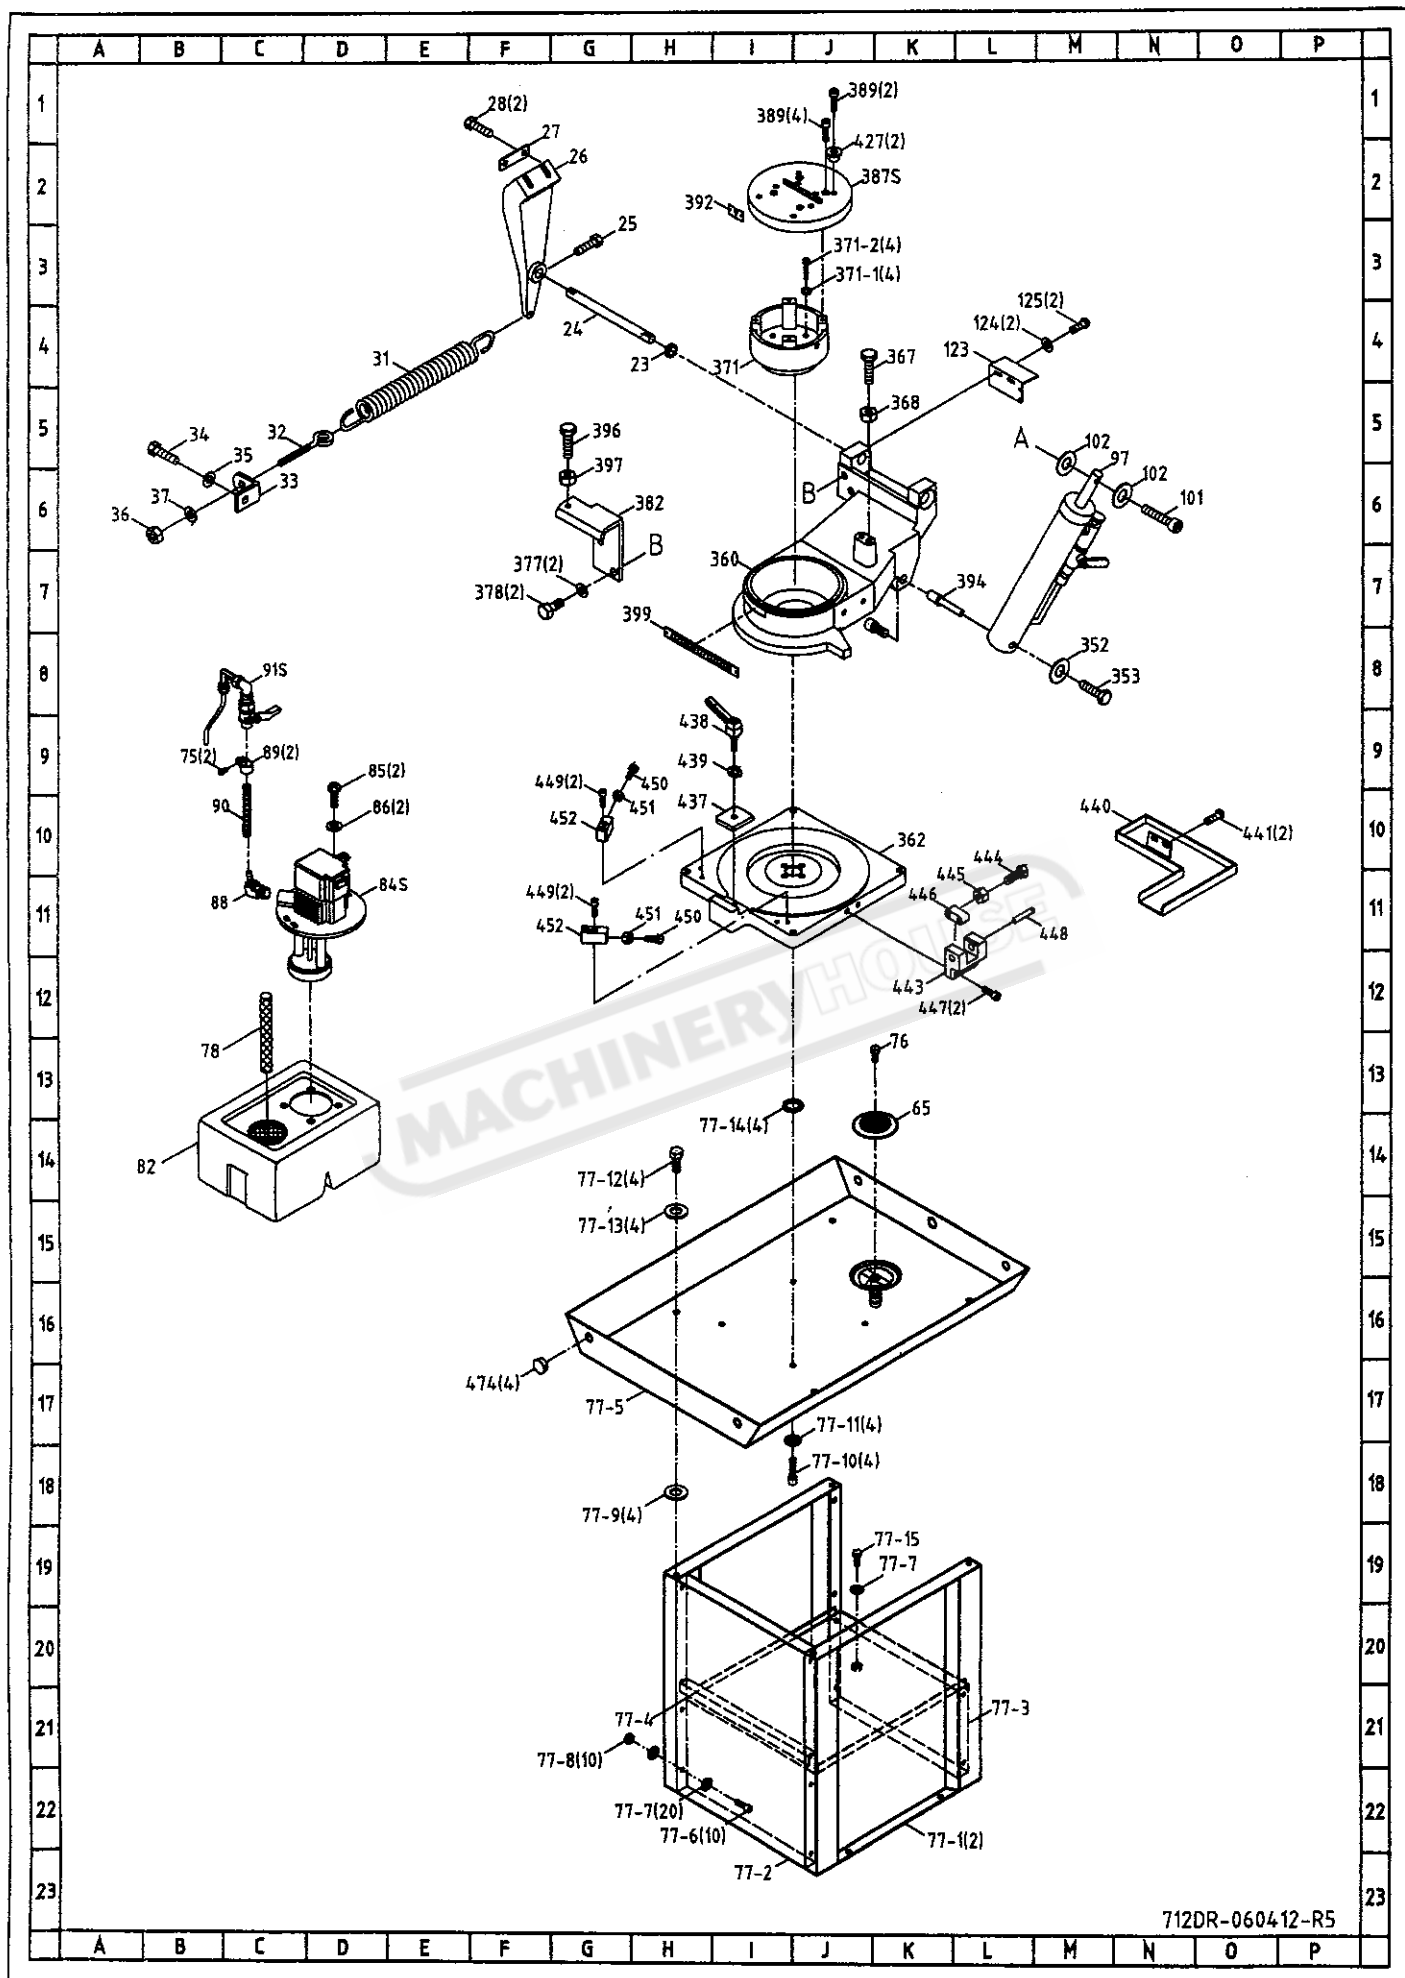

## PARTS LIST

## MODEL NO. 712DR

| CODE NO | PART NO    | DESCRIPTION             | SPECIFICATION    | QTY | NOTE   |
|---------|------------|-------------------------|------------------|-----|--------|
| 7       | 181266     | Fixed Bolt              |                  | 1   |        |
| 8       | W008       | Washer                  | 3/8"x25xt2       | 2   |        |
| 20      | S012       | Hex. Head Screw         | 3/8"x1-1/2"L     | 1   |        |
| 23      | 181121     | Bushing                 |                  | 1   |        |
| 24      | 181122-1   | Support Rod             |                  | 1   |        |
| 25      | S063       | Screw                   | 5/16"x3/4"L      | 1   |        |
| 26      | 181123     | Pivot Bracket           |                  | 1   |        |
| 27      | 181270     | Washer                  |                  | 1   |        |
| 28      | S012       | Hex. Head Screw         | 3/8"x1-1/2"L     | 2   |        |
| 31      | 182050     | Spring                  |                  | 1   |        |
| 32      | 182049     | Spring Adjusting Screw  |                  | 1   |        |
| 33      | 182003     | Spring Bracket          |                  | 1   |        |
| 34      | S022       | Hex. Head Screw         | 5/16"x3/4"L      | 1   |        |
| 35      | W016       | Washer                  | 5/16"x23xt2      | 1   |        |
| 36      | N005       | Hex. Nut                | 3/8"             | 1   |        |
| 37      | W014       | Washer                  | 3/8"x23xt2       | 1   |        |
| 38      | 181130     | Thumb Screw             |                  | 1   |        |
| 39      | S022       | Hex. Head Screw         | 5/16"x3/4"L      | 1   |        |
| 40      | 3021       | Stock Stop Rod          |                  | 1   |        |
| 40      | 3021A      | Stock Stop Rod          |                  | 1   | Option |
| 41      | 181125     | Stop Block              |                  | 1   |        |
| 65      | 191106A    | Filter                  |                  | 1   |        |
| 75      | S708       | Cross Round Head Screw  | 3/16"x3/8"L      | 2   |        |
| 76      | S006       | Hex. Head Screw         | 1/4"-20*1/2"L    | 1   |        |
| 77S     | 182028ES   | Stand Complete Assembly |                  | 1   |        |
| 77-1    | 182028E1-1 | Stand Leg(Right)(Left)  |                  | 2   |        |
| 77-2    | 182028E1-2 | Stand Leg (front)       |                  | 1   |        |
| 77-3    | 182028E1-3 | Stand Leg (Back)        |                  | 1   |        |
| 77-4    | 182028E1-4 | Middle Plate of Stand   |                  | 1   |        |
| 77-5    | 182028E    | Chip Pan                |                  | 1   |        |
| 77-6    | HS242      | Hex. Socket Head Screw  | M8-1.25Px20L     | 11  |        |
| 77-7    | HW005      | Washer                  | 8.5*18-1.6t (M8) | 21  |        |
| 77-8    | HN005      | Hex. Nut                | M8               | 10  |        |
| 77-9    | 195058     | Rubber Washer           | φ 11*22-2        | 4   |        |
| 77-10   | HS242      | Hex. Socket Head Screw  | M8-1.25Px20L     | 4   |        |
| 77-11   | W015       | Washer                  | M8x23xt2         | 4   |        |
| 77-12   | HS058      | Hex. Head Screw         | M10X20L          | 4   |        |
| 77-13   | HW006      | Washer                  | M10X20Xt2        | 4   |        |
| 77-14   | HO028      | O-Retainer Ring         | φ 2x φ 10        | 4   |        |
| 78      | 182076     | Hose                    | 3/4"x200mm       | 1   |        |
| 82      | 181256     | Coolant Tank            |                  | 1   |        |

## PARTS LIST

MODEL NO. 712DR

| CODE NO | PART NO   | DESCRIPTION                  | SPECIFICATION | QTY | NOTE                 |
|---------|-----------|------------------------------|---------------|-----|----------------------|
| 84S     |           | Pump                         |               | 1   |                      |
| 85      | S717      | Cross Round Head Screw       | 1/4"x5/8"L    | 2   |                      |
| 86      | W004      | Washer                       | 1/4"x19xt1.5  | 2   |                      |
| 88      | 181852    | Coupler                      | 3/8"PTx5/16"  | 1   |                      |
| 89      | 181601    | Hose Clip                    | 5/8"          | 2   |                      |
| 90      | 181981    | Hose                         | 0D12xID8x2000 | 1   |                      |
| 97      | 182042    | Cylinder Complete Set        |               | 1   |                      |
| 101     | S412      | Hex. Socket Head Screw       | 3/8"x2-1/4"L  | 1   |                      |
| 102     | W014      | Washer                       | 3/8"x23xt2    | 2   |                      |
| 123     | 193046    | Power Cutting Bracket        |               | 1   |                      |
| 124     | W007      | Washer                       | M5            | 2   |                      |
| 125     | S721      | Cross Round Head Screw       | M5x10L        | 2   |                      |
| 130     | 181306    | Bracket                      |               | 1   | For CE Only          |
| 130     | 181306A   | Bracket                      |               | 1   | For CE Only (Option) |
| 131     | HS508     | Cross Round Head Screw       | M4x5L         | 4   | For CE Only          |
| 132     | 181305    | Switch Base                  |               | 1   | For CE Only          |
| 132     | 181305A   | Switch base                  |               | 1   | For CE Only (Option) |
| 133     | HW003     | Washer                       | M5            | 2   | For CE Only          |
| 134     | HW509     | Cross Round Head Screw       | M4x10L        | 2   | For CE Only          |
| 201S    | 18121     | Gear Box Assembly            |               | 1   |                      |
| 202S    | 18138     | Worm Gear Shaft Assembly     |               | 1   |                      |
| 203     | HK110     | Key                          | 5x5x30L       | 1   |                      |
| 206     | 181226B   | Spindle Pulley               |               | 1   |                      |
| 207     | S604      | Hex. Socker Headless Screw   | 1/4"x3/8"L    | 2   |                      |
| 208     | 181874    | Belt                         | 3Vx270        | 1   |                      |
| 209     | 181237D   | Cover                        |               | 1   |                      |
| 210     | N005      | Hex. Nut                     | 3/8"          | 1   |                      |
| 211     | W013      | Washer                       | 3/8"x20xt2    | 1   |                      |
| 212     | 181302-2  | Cylinder Upper Support       |               | 1   |                      |
| 213     | W017      | Washer                       | 5/16"x18xt1.5 | 3   |                      |
| 214     | S017      | Hex. Head Screw              | 5/16"x1"L     | 3   |                      |
| 218     | 181203-1  | Body Frame                   |               | 1   |                      |
| 219     | W204      | Spring Washer                | 3/8"          | 4   |                      |
| 220     | S013      | Hex. Head Screw              | 3/8"x1-1/4"L  | 4   |                      |
| 230     | HCS13     | C-Retainer Ring              | S25           | 1   |                      |
| 231S    | 181214-2S | Drive Wheel                  |               | 1   |                      |
| 232     | HK025     | Key                          | 6x6x20L       | 1   |                      |
| 233     | S022      | Hex. Head Screw              | 5/16"x3/4"L   | 1   |                      |
| 234     | S201      | Cross Socker Hex. Head Screw | 1/4"x5/8"L    | 2   |                      |
| 235     | W005      | Washer                       | 1/4"x16xt1.5  | 2   |                      |
| 236     | 181232-1  | Support Plate                |               | 1   |                      |

## PARTS LIST

## MODEL NO. 712DR

| CODE NO | PART NO  | DESCRIPTION                        | SPECIFICATION         | QTY | NOTE        |
|---------|----------|------------------------------------|-----------------------|-----|-------------|
| 237     | 181210   | Sliding Plate                      |                       | 2   |             |
| 238     | 181211   | Blade Tension Sliding Block        |                       | 1   |             |
| 239     | S608     | Hex. Socker Headless Screw         | 5/16"x3/4"L           | 1   |             |
| 240     | S019     | Hex. Head Screw                    | 5/16"x1-1/2"L         | 2   |             |
| 241     | W015     | Washer                             | 5/16"x12xt2           | 2   |             |
| 242     | W205     | Spring Washer                      | 5/16"                 | 4   |             |
| 243     | S020     | Hex. Head Screw                    | 5/16"x3/4"L           | 4   |             |
| 244     | 181212   | Spring                             |                       | 1   |             |
| 245     | 181213A  | Blade Adjustable Knob              |                       | 1   |             |
| 246     | W008     | Washer                             | 3/8"x25xt2            | 1   |             |
| 249S    | 18122    | Shaft Assembly                     |                       | 1   |             |
| 250S    | 18123A   | Idler Wheel Assembly               |                       | 1   |             |
| 251     | 181894-2 | Blade                              | 0.032"x3/4"x93"x6-10T | 1   |             |
| 252     | 181240   | Switch Cut Off Tip                 |                       | 1   |             |
| 253     | W005     | Washer                             | 1/4"x16xt1.5          | 1   |             |
| 254     | S201     | Cross Socker Hex. Head Screw       | 1/4"x5/8"L            | 1   |             |
| 255     | S013     | Hex. Head Screw                    | 3/8"x1-1/4"L          | 1   |             |
| 256     | W008     | Washer                             | 3/8"x25xt2            | 1   |             |
| 258S    | 181242BS | Brush Assembly                     |                       | 1   |             |
| 259     | S708     | Cross Round Head Screw             | 3/16"x3/8"L           | 2   |             |
| 261     | 3066-3   | Blade Adjustable Knob              |                       | 1   |             |
| 262     | W008     | Washer                             | 3/8"x25xt2            | 1   |             |
| 266S    | 18128A   | Adjustable Bracket Assembly (Rear) |                       | 1   |             |
| 267S    | 18126    | Guide Pivot Assembly               |                       | 1   |             |
| 268S    | 18127    | Bearing Shaft Assembly             |                       | 1   |             |
| 269S    | 18124K   | Adjustable Bracket (Front)         |                       | 1   |             |
| 270S    | 18126    | Guide Pivot Assembly               |                       | 1   |             |
| 271S    | 18127    | Bearing Shaft Assembly             |                       | 1   |             |
| 279     | 181231   | Blade Cover(Front)                 |                       | 1   |             |
| 280     | S711     | Cross Round Head Screw             | 5/32"x1/4"L           | 2   |             |
| 284     | 195083   | Plum handle                        |                       | 2   |             |
| 285     | W005     | Washer                             | 1/4"x16xt1.5          | 2   |             |
| 286S    | 18137    | Blade Back Cover                   |                       | 1   |             |
| 288     | W005     | Washer                             | 1/4"x16xt1.5          | 4   |             |
| 289     | S701     | Cross Round Head Screw             | 1/4"x1/2"L            | 4   |             |
| 290     | S201     | Cross Socker Hex. Head Screw       | 1/4"x1/2"L            | 1   | For CE Only |
| 290     | 3058     | Plum handle                        |                       | 1   |             |
| 291     | 181237I  | Motor Pulley Cover                 |                       | 1   |             |
| 293     | S201     | Cross Socker Hex. Head Screw       | 1/4"x5/8"L            | 2   |             |
| 294     | W004     | Washer                             | 1/4"x19xt1.5          | 2   |             |
| 295     | HK110    | Key                                | 5x5x30L               | 1   |             |

## PARTS LIST


MODEL NO. 712DR


| CODE NO | PART NO | DESCRIPTION                | SPECIFICATION | QTY | NOTE                 |
|---------|---------|----------------------------|---------------|-----|----------------------|
| 296     | 181235B | Motor Pulley               |               | 1   |                      |
| 297     | S604    | Hex. Socker Headless Screw | 1/4"x3/8"L    | 1   |                      |
| 298     | S510    | Carriage Screw             | 5/16"x3/4"L   | 4   |                      |
| 300     |         | Motor                      |               | 1   |                      |
| 301     | S017    | Hex. Head Screw            | 5/16"x1"L     | 2   |                      |
| 302     | N007    | Hex. Nut                   | 5/16"         | 2   |                      |
| 303     | 181234A | Motor Mount Plate          |               | 1   |                      |
| 304     | N007    | Hex. Nut                   | 5/16"         | 4   |                      |
| 305     | S022    | Hex. Head Screw            | 5/16"x3/4"L   | 4   |                      |
| 306     | W016    | Washer                     | 5/16"x23xt2   | 12  |                      |
| 307     | 181233A | Motor Mount Bracket        |               | 1   |                      |
| 307-1   | W016    | Washer                     | 5/16"X23Xt2   | 2   |                      |
| 307-2   | S020    | Hex. Head Screw            | 5/16"X7/8"L   | 2   |                      |
| 343     | W005    | Washer                     | 1/4"x16xt1.5  | 1   | For CE Only          |
| 345     | 181991  | Emergency Switch Bracket   |               | 1   | For CE Only          |
| 345     | 181998  | Emergency Switch Bracket   |               | 1   | For CE Only (Option) |
| 348     | S727    | Cross Round Head Screw     | M6x12L        | 4   | For CE Only          |
| 351     | S407    | Hex. Socket Head Screw     | 3/16"x3/8"L   | 2   | For CE Only          |
| 352     | W016    | Washer                     | 5/16"x19xt1.5 | 1   |                      |
| 353     | S018    | Hex. Head Screw            | 5/16"x1/2"L   | 1   |                      |
| 360     | 182020D | Swivel Arm                 |               | 1   |                      |
| 362     | 182017B | Swivel Base                |               | 1   |                      |
| 363     | 182044A | Vise Base                  |               | 1   |                      |
| 367     | 193032  | Bolt                       | 1/2"x2-1/2"L  | 1   |                      |
| 368     | N001    | Hex. Nut                   | 1/2"          | 1   |                      |
| 371     | 193010  | Fixed Shaft                |               | 1   |                      |
| 371-1   | W204    | Spring Washer              | 3/8"          | 4   |                      |
| 371-2   | S410    | Hex. Socket Head Screw     | 3/8"x1-1/2"L  | 4   |                      |
| 377     | W017    | Washer                     | 5/16"x18xt1.5 | 2   |                      |
| 378     | S022    | Hex. Head Screw            | 5/16"x3/4"L   | 2   |                      |
| 382     | 182004A | Bracket                    |               | 1   |                      |
| 385     | 182043  | Vise Jaw Bracket(Rear)     |               | 1   |                      |
| 386     | 182016  | Vise Jaw Bracket(Front)    |               | 1   |                      |
| 387S    | 182041S | Cap                        |               | 1   |                      |
| 389     | S416    | Hex. Socket Head Screw     | M8x25L        | 6   |                      |
| 390     | S425    | Hex. Socket Head Screw     | M10x30L       | 4   |                      |
| 392     | 1976015 | Meter Indicator            |               | 1   |                      |
| 394     | 182045  | Cylinder Lower Support     |               | 1   |                      |
| 395     | S023    | Hex. Head Screw            | 5/16"x1-1/4"L | 3   |                      |
| 396     | S013    | Hex. Head Screw            | 5/16"x1-1/4"L | 1   |                      |
| 397     | N007    | Hex. Nut                   | 5/16"         | 1   |                      |

## PARTS LIST

## MODEL NO. 712DR

| CODE NO | PART NO | DESCRIPTION                 | SPECIFICATION | QTY | NOTE       |
|---------|---------|-----------------------------|---------------|-----|------------|
| 399     | 182014A | Degree-Meter                |               | 1   |            |
| 401     | S063    | Screw                       | 5/16"x3/4"L   | 1   |            |
| 402     | W016    | Washer                      | 5/16"x23xt2   | 2   |            |
| 403     | 182024  | Fixed Plate                 |               | 1   |            |
| 404     | S206    | Hex. Head Screw             | 5/16"x3/4"L   | 1   |            |
| 427     | 182047  | Fix Block                   |               | 2   |            |
| 437     | 182060  | Swivel Arm Briquette        |               | 1   |            |
| 438     | 191210A | Knob                        |               | 1   |            |
| 439     | W204    | Spring Washer               | 3/8"          | 1   |            |
| 440     | 182061A | Splash Board                |               | 1   |            |
| 441     | S732    | Cross Round Head Screw      | 5/16"x1/2"L   | 2   |            |
| 443     | 193029  | Protractor Locating Bracket |               | 1   |            |
| 444     | S015    | Hexagon head screw          | 3/8"x2"L      | 1   |            |
| 445     | N005    | Hex. Nut                    | 3/8"          | 1   |            |
| 446     | 193030  | Protractor Locating Block   |               | 1   |            |
| 447     | S415    | Hexagon screw               | 5/16"x1/2"L   | 2   |            |
| 448     | 103026  | Bearing Pin                 |               | 1   |            |
| 449     | S007    | Hex. Socket Head Screw      | 1/4"x1-1/4"L  | 4   |            |
| 450     | S015    | Hexagon head screw          | 3/8"x2"L      | 2   |            |
| 451     | N005    | Hex. Nut                    | 3/8"          | 2   |            |
| 452     | 193025  | Swivel Locating Block       |               | 2   |            |
| 468     | 182065  | Extension Base              |               | 1   |            |
| 469     | S476    | Hex. Socket Head Screw      | 3/8"x1-1/4"   | 2   |            |
| 474     | ET2135  | Snap Bushing                |               | 4   |            |
| 600     | 3027-1  | Knob                        |               | 1   | All thread |
| 601     | 193057  | Knob                        |               | 1   | All thread |
| 602     | S601    | Hex. Socker Headless Screw  | 1/4"x1/2"L    | 1   | All thread |
| 603     | 193055  | Presure Lump                |               | 1   | All thread |
| 604     | HW007   | Washer                      | § 12xt2       | 1   | All thread |
| 605     | S013    | Hex. Head Screw             | 3/8"x1-1/4"L  | 2   | All thread |
| 606     | W013    | Washer                      | 3/8"x20xt2    | 2   | All thread |
| 608     | 193056  | Presure Shaft               |               | 1   | All thread |
| 609     | 193059  | Knob W/Shaft                |               | 1   | All thread |
| 610     | 290086  | Plastic Round Knob          |               | 1   | All thread |
| 611     | CA51101 | Bearing                     |               | 1   | All thread |
| 612     | HW007   | Washer                      | § 12xt2       | 1   | All thread |
| 613     | 193058  | Spring                      |               | 1   | All thread |
| 614     | 182037B | Acme Screw                  |               | 1   | All thread |
| 615     | 181138B | Acme Nut                    |               | 1   | All thread |
| 616     | W002    | Washer                      | 1/2"x28xt2    | 1   | All thread |

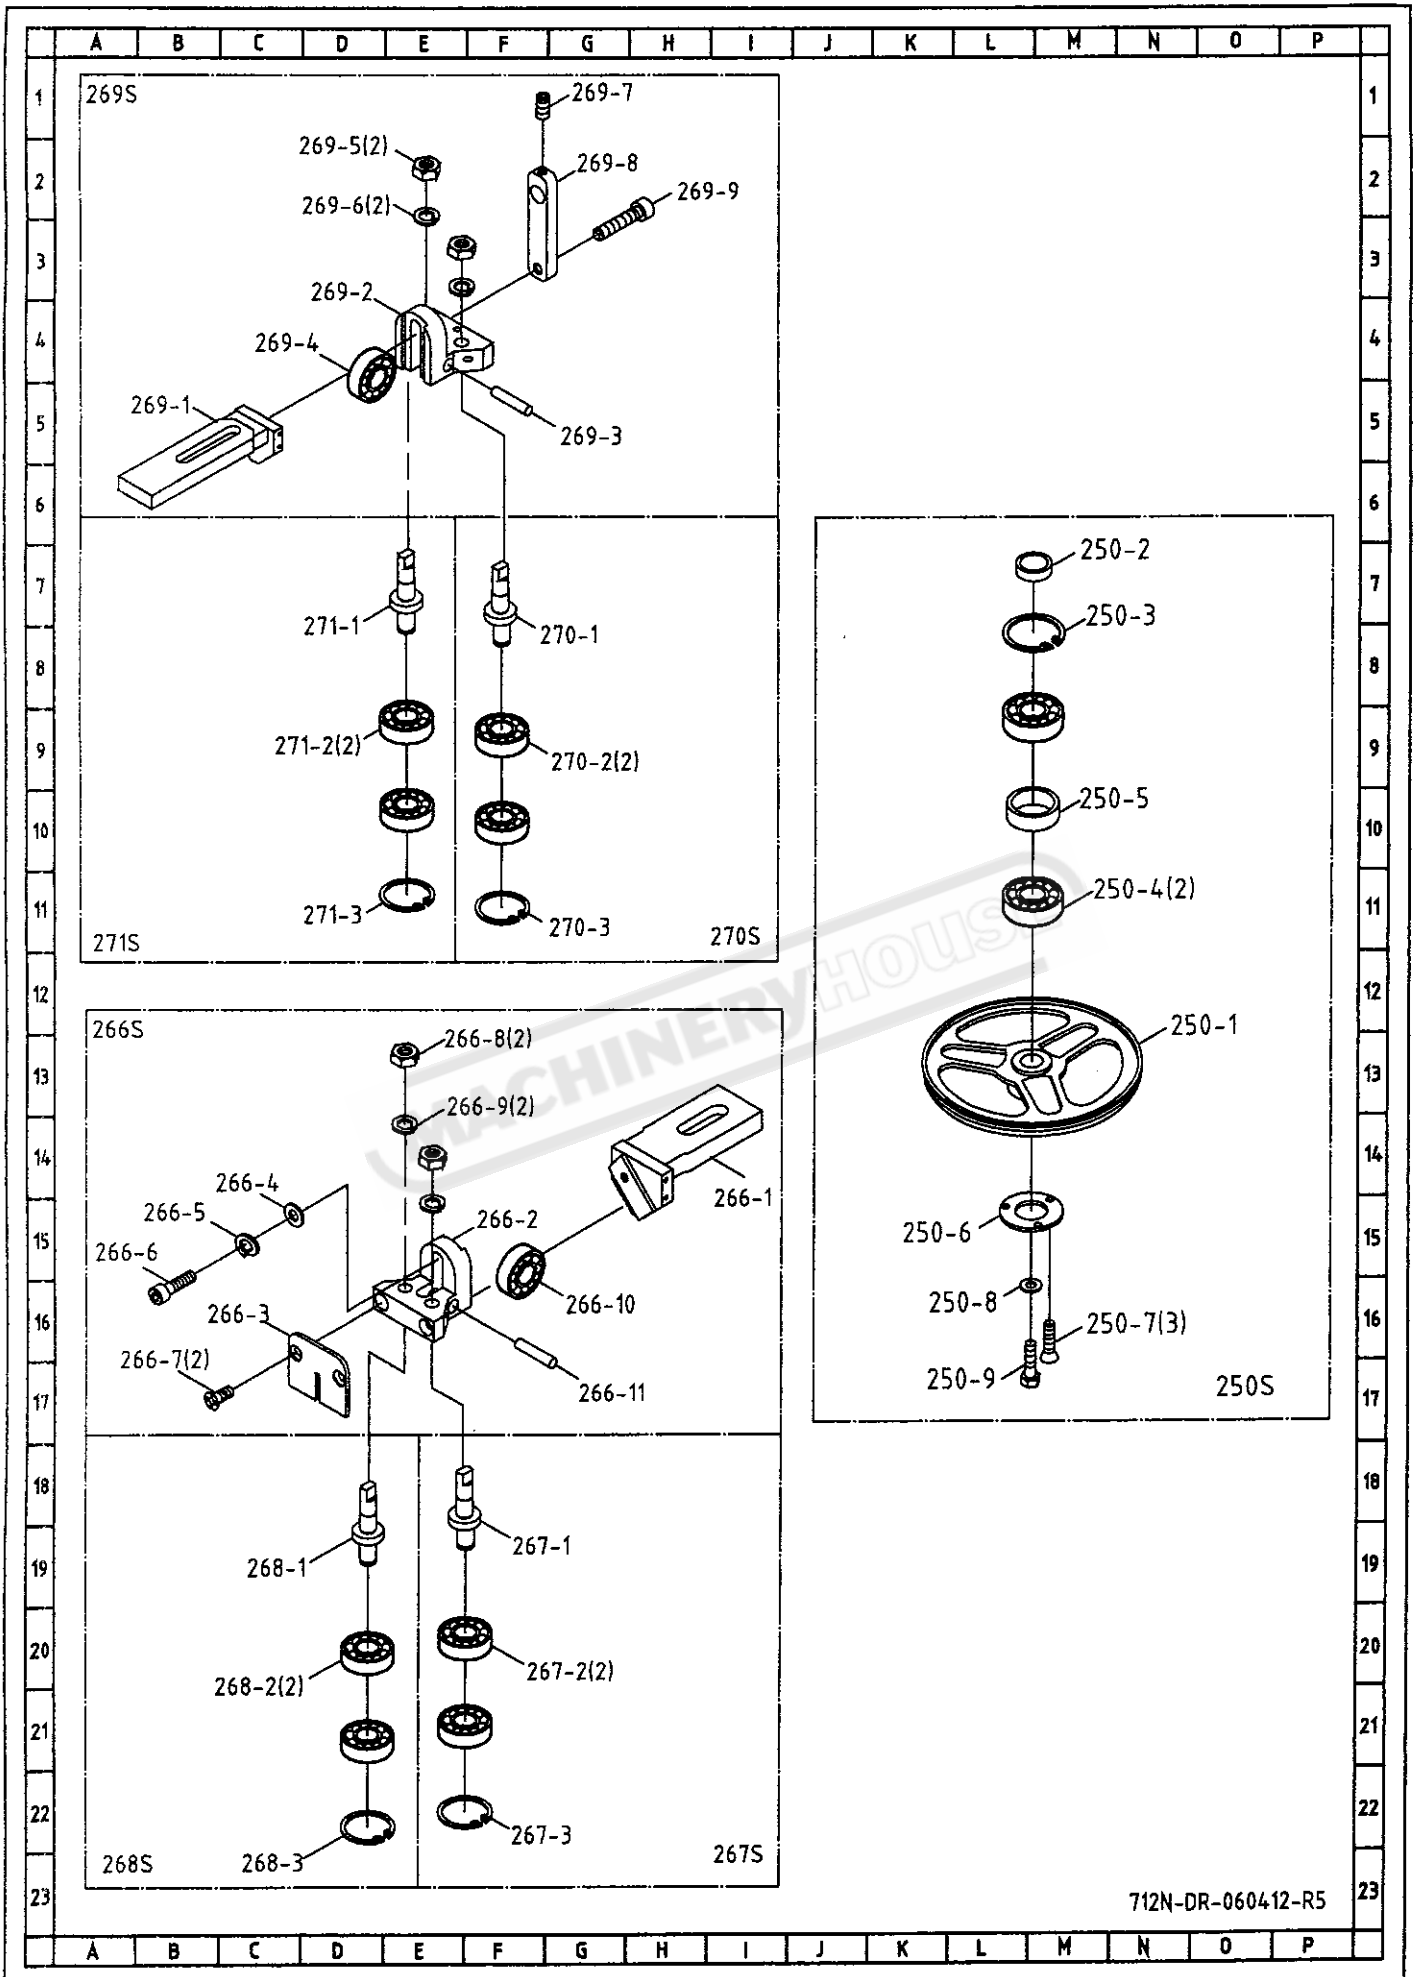

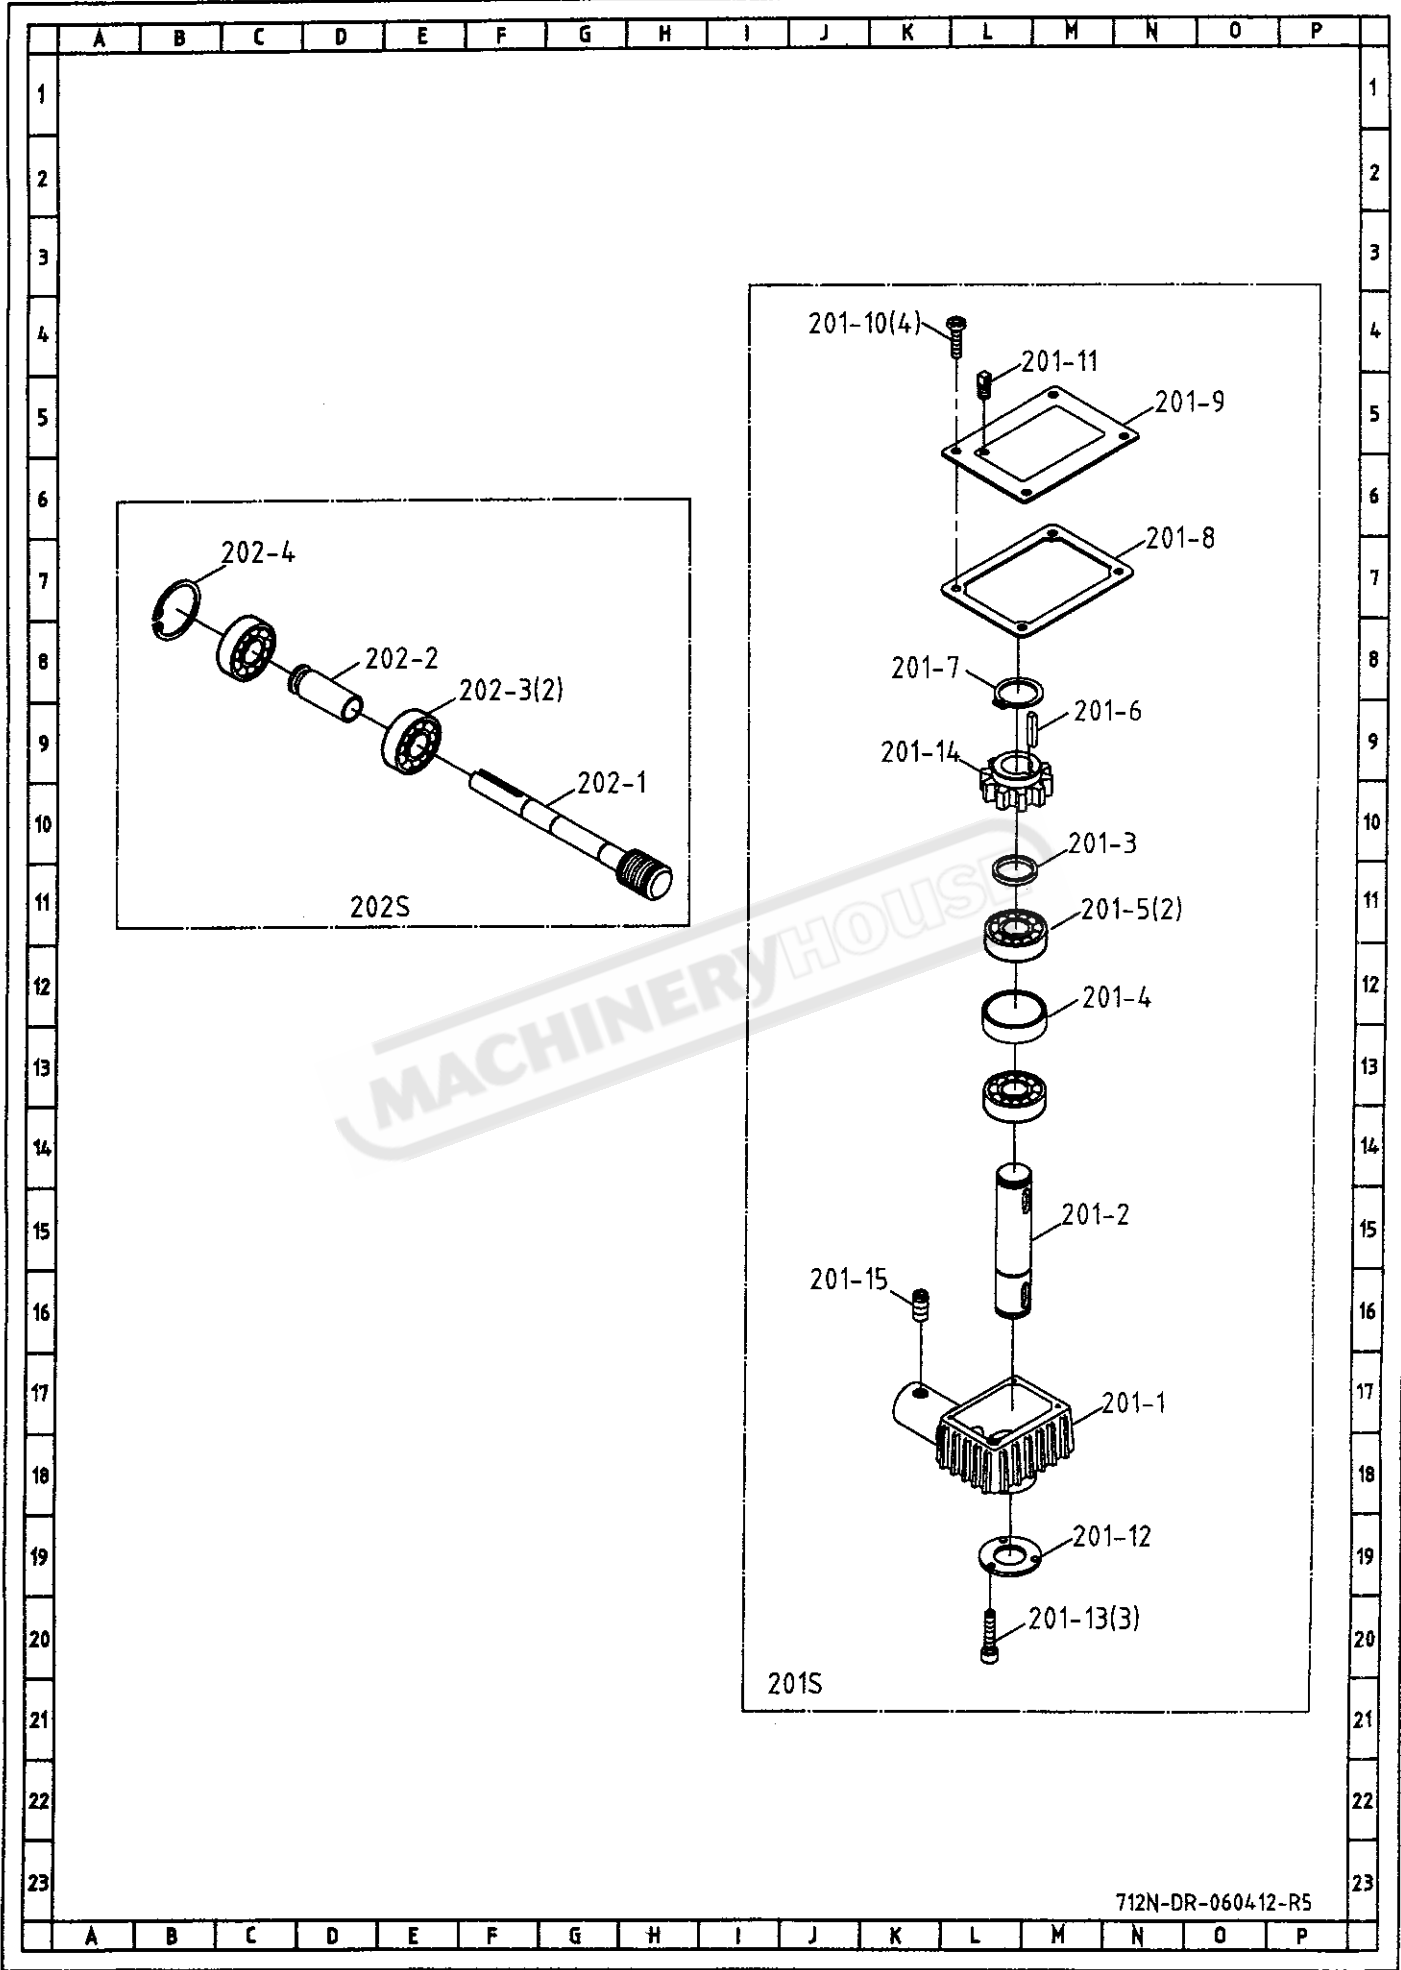

## PARTS LIST

MODEL NO. 712N-DR G0561

| CODE NO | PART NO   | DESCRIPTION                  | SPECIFICATION | QTY | NOTE |
|---------|-----------|------------------------------|---------------|-----|------|
| 201-1   | 181216A   | Gear Box                     |               | 1   |      |
| 201-2   | 181219-1  | Transmission Wheel Shaft     |               | 1   |      |
| 201-3   | 181218-1  | Bushing                      |               | 1   |      |
| 201-4   | 181217-1  | Bushing                      |               | 1   |      |
| 201-5   | CA6205LLU | Bearing                      | 6205LLU       | 2   |      |
| 201-6   | HK025     | Key                          | 6x6x20L       | 1   |      |
| 201-7   | HCS13     | C-Retainer Ring              | S25           | 1   |      |
| 201-8   | 3092      | Gear Box Gasket              |               | 1   |      |
| 201-9   | 181222-1  | Gear Box Cover               |               | 1   |      |
| 201-10  | S201      | Cross Socker Hex. Head Screw | 1/4"x5/8"L    | 4   |      |
| 201-11  | 3149      | Vent Plug                    | M8xP1         | 1   |      |
| 201-12  | 181246    | Bearing Cover                |               | 1   |      |
| 201-13  | S708      | Cross Round Head Screw       | 3/16"x3/8"L   | 3   |      |
| 201-14  | 181220-1  | Worm Gear                    |               | 1   |      |
| 201-15  | S607      | Hex. Socker Headless Screw   | 5/16"x1/2"L   | 1   |      |
| 202-1   | 181223    | Worm Shaft                   |               | 1   |      |
| 202-2   | 181224    | Bearing Bushing              |               | 1   |      |
| 202-3   | CA6003LLU | Bearing                      | 6003LLU       | 2   |      |
| 202-4   | HCS06     | C-Retainer Ring              | S17           | 1   |      |
| 250-1   | 181205-2  | Idler Wheel                  |               | 1   |      |
| 250-2   | 181207-1  | Bushing                      |               | 1   |      |
| 250-3   | HCR04     | C-Retainer Ring              | R35           | 1   |      |
| 250-4   | CA6202ZZ  | Ball Bearing                 | 6202ZZ        | 2   |      |
| 250-5   | 181245    | Bushing                      |               | 1   |      |
| 250-6   | 3072-2    | Bearing Cover                |               | 1   |      |
| 250-7   | S302      | Flat Cross Head Screw        | 3/16"x3/8"L   | 3   |      |
| 250-8   | W018      | Washer                       | 5/16"x20xt3   | 1   |      |
| 250-9   | S022      | Hex. Head Screw              | 5/16"x3/4"L   | 1   |      |
| 266-1   | 181228A   | Adjustable Bracket(Rear)     |               | 1   |      |
| 266-2   | 3064      | Blade Adjustable (Rear)      |               | 1   |      |
| 266-3   | 3069      | Deflector Plate              |               | 1   |      |
| 266-4   | W017      | Washer                       | 5/16"x18xt1.5 | 1   |      |
| 266-5   | W205      | Spring Washer                | 5/16"         | 1   |      |
| 266-6   | S416      | Hex. Socket Head Screw       | 5/16"x1-1/4"L | 1   |      |
| 266-7   | S301      | Flat Cross Head Screw        | 1/4"x1/2"L    | 2   |      |
| 266-8   | N006      | Hex. Nut                     | 3/8"UNF       | 2   |      |
| 266-9   | W204      | Spring Washer                | 3/8"          | 2   |      |
| 266-10  | CA6000ZZ  | Bearing                      | 6000ZZ        | 1   |      |
| 266-11  | 3063      | Bearing Pin                  |               | 1   |      |

## PARTS LIST

MODEL NO. 712N-DR G0561

| CODE NO | PART NO  | DESCRIPTION                | SPECIFICATION | QTY | NOTE   |
|---------|----------|----------------------------|---------------|-----|--------|
| 267-1   | 181244   | Guide Pivot                |               | 1   |        |
| 267-2   | CA6000ZZ | Bearing                    | 6000ZZ        | 2   |        |
| 267-3   | HCS01    | C-Retainer Ring            | S10           | 1   |        |
| 268-1   | 181243   | Bearing Shaft              |               | 1   |        |
| 268-2   | CA6000ZZ | Bearing                    | 6000ZZ        | 2   |        |
| 268-3   | HCS01    | C-Retainer Ring            | S10           | 1   |        |
| 269-1   | 181230-1 | Adjustable Bracket(Front)  |               | 1   |        |
| 269-2   | 181271   | Blade Adjustable (Front)   |               | 1   |        |
| 269-3   | 3063     | Bearing Pin                |               | 1   |        |
| 269-4   | CA6000ZZ | Bearing                    | 6000ZZ        | 1   | Option |
| 269-5   | N006     | Hex. Nut                   | 3/8"UNF       | 2   |        |
| 269-6   | W204     | Spring Washer              | 3/8"          | 2   |        |
| 269-7   | S604     | Hex. Socker Headless Screw | 1/4"x3/8"L    | 1   |        |
| 269-8   | 0162     | Nozzle Cock Support        |               | 1   |        |
| 269-9   | S416     | Hex. Socket Head Screw     | 5/16"x1-1/4"L | 1   |        |
| 270-1   | 181244   | Guide Pivot (Right)        |               | 1   |        |
| 270-2   | CA6000ZZ | Bearing                    | 6000ZZ        | 2   |        |
| 270-3   | HCS01    | C-Retainer Ring            | S10           | 1   |        |
| 271-1   | 181243   | Bearing Shaft              |               | 1   |        |
| 271-2   | CA6000ZZ | Bearing                    | 6000ZZ        | 2   |        |
| 271-3   | HCS01    | C-Retainer Ring            | S10           | 1   |        |

MACHINERYHOUSE

**MANUFACTURER:**

**ADDRESS:**

**SERIAL No.:**

PLEASE WRITE DOWN THE SERIAL NO. ON THIS BLOCK FROM THE NAME  
PLATE AFTER YOU RECEIVE THIS MACHINE.