



Measurmax

ELECTRONIC CALIPER GAUGE OPERATION MANUAL

1. Functional elements

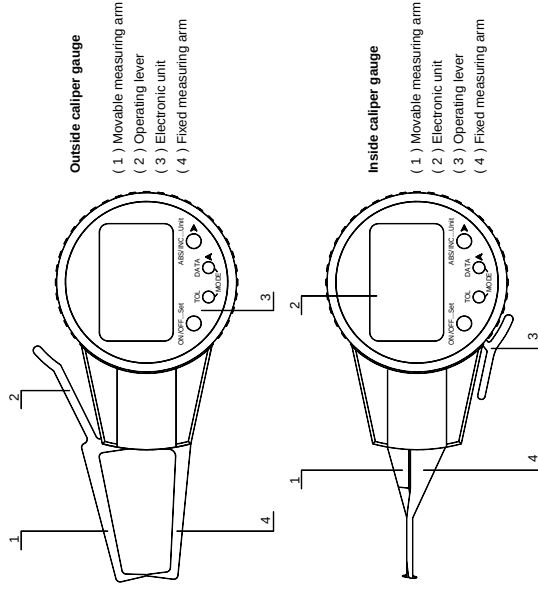

2. LCD display

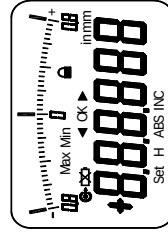

- Min : Find and save the minimum
- Max : Find and save the maximum
- H : Find and save steady value
- OK : Lock saved value and its position
- DATA : Data output to PC
- Battery voltage is low
- Upper tolerance limit
- Lower tolerance limit
- Within tolerance limits
- OK : Analog display graduation range
- In : Inch measuring mode
- mm : Metric measuring mode
- ABS : Absolute measuring mode
- INC : Relative measuring mode
- Set : Set the origin

3. Operation

Two ways of pressing key are used in the following illustration:

- (1) Press and release ; (2) Press and hold (more than 1 sec.)

3.1 ON/OFF...Set

- ON/OFF : Power on/off
- Set : Set the origin

3.2 ABS/INC...Unit and

- ABS/INC : Absolute/Relative measuring mode conversion
- Unit : Metric/inch measuring mode conversion
- Move flashing digit from left to right during setting

www.measurmax.com

3.3 TOL

Set tolerance and tolerance monitoring.

3.4 DATA and

Output the data to PC once, " " flashes once.

3.5 MODE


The flashing digit plus 1 or $\pm$ change during setting.

Press "TOL" key and "DATA" key simultaneously: change the measuring mode.

4. Set the origin


- a. Press and hold "Set" key until "Set" appears.
- b. Press " " key or " " key to adjust the displayed data until it is desired.
- c. Press "Set" key at any time, the displayed data will be stored as the origin and enter absolute measuring mode.

For example: set the origin to 1.020mm

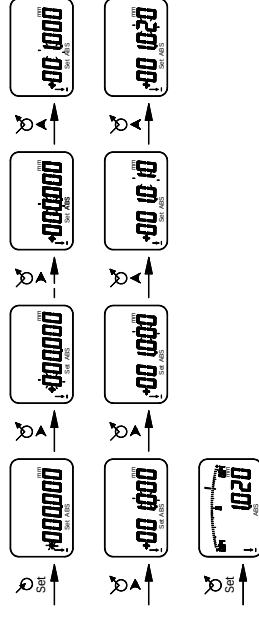


5. Set tolerance and tolerance monitoring.

- a. Press "TOL" key to set upper limit with " " displayed.
 - b. Press " " key or " " key to adjust the displayed data until it is desired.
 - c. Press "TOL" key to set lower limit with " " displayed.
 - d. Press " " key or " " key to adjust the displayed data until it is desired.
 - e. Press "TOL" key at any time, the gauge will enter tolerance monitoring measurement.
 - f. Tolerance monitoring measurement.
 - g. Press "TOL" key again will exit tolerance monitoring measurement.
- Attention: Upper limit must > lower limit
 - For example: set upper limit +0.2, lower limit -0.1

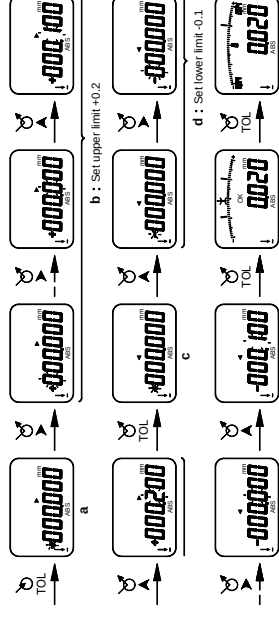


e.f : Tolerance monitoring g : Exit tolerance monitoring

 Tolerance monitoring:



6. Select measuring mode

 The gauge has 4 measuring modes. Press "TOL" key and "DATA" key simultaneously to change measuring mode, "Min", "Max", "H" and non-sign will be displayed in turn. You should release operating lever and let measuring arms free when select measuring mode.



6.1 Normal measuring mode

Displaying value is the distance between caliper's measuring contacts in this mode.

 
6.2 Find and save the minimum automatically

"Min" flashing in this mode. "Min" stops flashing when measured value is steady >1 sec, this value and its position will be saved. "Min" starts flashing again when pivoting measuring arm. "Min" stops flashing when measured value is steady >1 sec. The gauge will find and display the minimum from saved data. After release operating lever and let measuring arms free, the gauge will display " " and the minimum, and record its position. You can repeat the above process when moving measuring arm again.



Outside caliper gauge

Measuring thickness or external diameter in "Min" mode. Steadily pivot the gauge vertically to find the minimum.



Inside caliper gauge

Measuring bore diameter in "Min" mode. Steadily pivot the gauge vertically to find the minimum.



6.3 Find and save the maximum automatically


"Max" flashing in this mode. "Max" stops flashing when measured value is steady >1 sec, this value and its position will be saved. "Max" starts flashing again when pivoting measuring arm.

Measuring external groove diameter in "Max" mode.

Measuring internal groove diameter in "Max" mode.

6.4 Find and save steady value automatically

"H" flashing in this mode. "H" stops flashing when measured value is steady >1 sec, this value and its position will be saved. After release operating lever and let measuring arms free, the gauge will display "0" and the steady value, and record its position. You can repeat the above process when moving measuring arm again.

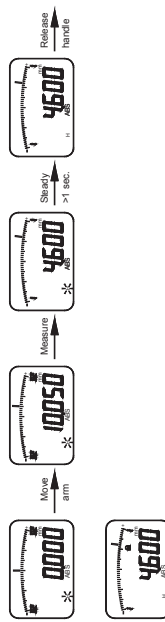

Measuring arm

Micrometer

Y

X

www.measurmax.com

- In automatically measuring mode, the origin calibrating will become more convenient and accurate. Follow chapter 6.2, find the minimum,  appears on LCD. Then, set the origin. At this time, wherever the measuring arm is the position of the minimum recorded by gauge. Follow chapter 6.3, find the maximum,  appears on LCD. Then, set the origin. At this time, wherever the measuring arm is the position of the maximum recorded by gauge.

Analog display in normal measuring mode is the fractional part of displayed value. Its range will change automatically.

Analog display range		Digital display range (Fractional part)		Analog display resolution	
mm	in	mm	in	mm	in
± 0.02	± 0.001	X 0.00—X 0.19	X 0.0000—X 0.0095	0.001	0.00005
± 0.04	± 0.002	X 0.20—X 0.39	X 0.0100—X 0.0195	0.002	0.0001
± 0.2	± 0.01	X 0.40—X 1.99	X 0.0200—X 0.0995	0.01	0.0005
± 0.4	± 0.02	X 2.00—X 3.99	X 0.1000—X 0.1995	0.02	0.001
± 1	± 0.1	X 4.00—X 9.99	X 0.2000—X 0.9995	0.05	0.005
	± 0.2		X 10.000—X 19.995		0.01
	± 1		X 20.000—X 99.995		0.05

Analog display range		Digital display range (Fractional part)		Analog display resolution	
mm	in	mm	in	mm	in
±0.1	±0.004	X.000—X.095	X.0000-X.0038	0.005	0.0002
±0.2	±0.01	X.100—X.195	X.0040-X.0098	0.01	0.0005
±0.4	±0.02	X.200—X.395	X.0100-X.0198	0.02	0.001
±1	±0.1	X.400—X.995	X.0200-X.0998	0.05	0.005
	±0.2		X.1000-X.1998		0.01
	±1		X.2000-X.9998		0.05

- Battery is a CR2032, 3V. Replace the battery when display is blurring or appears.
- If not used in about 5 minutes, the power will auto-off. The gauge will wake up when pressing "ON/OFF" key or moving measuring point.
- Power off the gauge by pressing "ON/OFF" key to save battery if not use.



- Data output interface is **R5232C**. The gauge can be connected to PC's serial port by **SPC** cable (Order No. **P1104**) or to PC's **USB** port by **SPC** cable + **USB** to serial port cable (Order No. **P1201**).

The gauge outputs data once if press the "DATA" key shortly, and flashes once.

- **Data format:**

Baud rate	Start bit	Data bit	Stop bit	Parity	Data logic
1200	1	7	2	none	reverse

- **Data format:**

Order	1	2	3	4	5	6	7	8	9	10
Metric	S	N1	N1	N	.	N	N	N	CR	LF
Inch	S	N	.	N	N	N	N	N	CR	LF

S: Minus or space
N1: Minus or space or digit 0-9
N : Digit 0-9

Resolution: 0 001mm/0 00005in 0 005mm/0 0002in

Mass: 0.407 g

Measuring range: 0-12.7111/0-0.311

Responding speed: 0.35m/s

Power consumption: $\leq 50\mu A$

Operating temperature: 0 ~ 40℃

Storage temperature: -20 ~ 60 °C

- Do not subject the gauge to blows or knocks.
- Do not drop the gauge or apply excessive force to the gauge.
- Do not disassemble the gauge.
- Do not press the key with a pointed object.
- Do not use or store the gauge under direct sunlight, or in an excessively hot or cold environment.
- Do not subject the gauge in strong magnetic fields and high voltage environment.
- Use soft cloth or cotton cleaning the gauge. Do not use any organic solvent such as acetone etc.
- Remove the battery if the gauge not use for a long time.



Failure	Causes	Repairing
Display E 1*	Measuring value over display range	Reset the origin or convert to relative measuring mode
Display E 2*	The origin is too great.	Reset the origin.
Display E 3*	Something wrong with sensor.	1. Reset the battery. 2. Return the gauge for repair.
Display E 4*	Upper limit < lower limit.	Reset tolerance.
Measuring value is not correct	1. Measuring surfaces are dirty 2. The origin isn't correct.	1. Clean measuring surfaces. 2. Reset the origin.
Display is confusing or dead	Suffer to strong disturb	Reset battery
No display	Battery voltage under 2.8V.	Replace battery.
Display is blurring - appears	Battery voltage under 2.8V.	Replace battery.

www.measurmax.com